

FORM
6Rev
05/18State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401722191

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC

Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required,

Name: Evins, Bret

Tel: (970) 420-6699

COGCC contact:

Email: bret.evins@state.co.us

API Number 05-123-20698-00

Well Name: WELLS RANCH

Well Number: 14-10

Location: QtrQtr: SWSW Section: 10 Township: 5N Range: 63W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.408500

Longitude: -104.430440

GPS Data:

Date of Measurement: 09/02/2008

PDOP Reading: 2.0

GPS Instrument Operator's Name: HOLLY L TRACY

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ Other

Casing to be pulled:

☐ Yes☒ No

Estimated Depth:

Fish in Hole:

☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6665	6671			
NIOBRARA	6410	6506			

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	421	300	421	0	VISU
1ST	7+7/8	4+1/2	10.5	6,837	650	6,837	0	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6360 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 40 sks cmt from 1800 ft. to 1300 ft. Plug Type: CASING Plug Tagged: ☐
Set 50 sks cmt from 621 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Plugging Date: _____
of _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Wells Ranch 14-10 (05-123-20698)/Plugging Procedure (Intent)

Producing Formation: Codell: 6665'-6671' Niobrara: 6410'-6506'

Upper Pierre Aquifer: 450'-1530'

TD: 6853' PBD: 6827'

Surface Casing: 8 5/8" 24# @ 421' w/ 300 sxs cmt

Production Casing: 4 1/2" 10.5# @ 6837.2' w/ 650 sxs cmt (TOC @ Surface' - CBL).

Tubing: 2 3/8" tubing set @ 6655.9' (1/13/2009).

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6360'. Top with 2 sxs 15.8#/gal CI G cement.
4. TIH w/ tubing to 1800'. RU cementing company. Mix and pump 40 sxs 15.8#/gal CI G cement down tubing. (Pierre coverage from 1800'-1300').
5. Pickup tubing to 621'. Mix and pump 50 sxs 15.8#/gal CL G cement down tubing. Cement should circulate to surface.
6. Cut surface casing 6' below ground level and weld on cap

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Jenifer Hakkarinen

Title: Reg Tech Date: _____ Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

COA Type

Description

--	--

Attachment Check List

Att Doc Num

Name

401722193	WELLBORE DIAGRAM
401722195	WELLBORE DIAGRAM
401722197	GYRO SURVEY

Total Attach: 3 Files

General Comments

User Group

Comment

Comment Date

		Stamp Upon Approval
--	--	------------------------

Total: 0 comment(s)