

Engineer: Clark Martin
Cell Phone Number: 970-371-4601

PLUG and ABANDONMENT PROCEDURE

HSR-CULLEN ODENBAUGH 14-12A

Description

1. Provide 48 hour notice to COGCC prior to rig up per request on approved Form 6 (e.g. call field coordinator, submit Form 42, etc.). Notify Automation Removal Group at least 24 hours prior to rig move. Request they catch and remove plunger, isolate production equipment, and remove any automation prior to rig MIRU.
2. MIRU Slickline. Pull production equipment and tag bottom. Record tag depth in Open Wells. Gyro was run on 11/14/14. RDMO Slickline.
3. Prepare location for base beam equipped rig. Install perimeter fence as needed.
4. Verify COAs before RU.
5. Upon RU, check and record bradenhead pressure. If bradenhead valve is not accessible, re-plumb so that valve is above GL. Blow down bradenhead and re-check pressure the next day. Repeat until pressure stays at 0 psi.
6. MIRU WO rig. Spot a minimum 25 jts of 2-3/8", 4.7# J-55 EUE tbq. Kill well as necessary using biocide treated fresh water. ND WH. NU BOP. Unland tbq using unlanding joint and LD. Release packer set at 6939'.
7. TOOH and SB all 2-3/8" tbq. LD packer.
8. PU and TIH with (4-1/2", 11.6#) Bit and Scraper on 2-3/8" tbq to 7320'. TOOH, SB 6900' of 2-3/8" tbq. LD Bit and Scraper and remaining tbq.
9. MIRU WL. PU and RIH with (4-1/2", 11.6#) CIBP and set at +/- 7310' (collars at 7280' & 7322'). POOH. RIH and dump 2 sx cement on CIBP. POOH.
10. PU and RIH with (4-1/2", 11.6#) CIBP and set at +/- 6900' (collars at 6884' & 6928'). POOH. RDMO WL.
11. MIRU Hydrotesters. TIH with 2-3/8" tbq to 6900' while hydrotesting to 3000 psi. RDMO Hydrotesters.
12. Load hole with biocide treated fresh water and circulate all gas out of well. PT CIBP to 1000psi for 15 minutes.
13. MIRU Cementers. Pump Niobrara Balance Plug: Pump 25 sx (6.9 bbl or 39 cf), assuming 15.8 ppg & 1.53 cf/sk. Volume based on 400' inside 4-1/2", 11.6# production casing with no excess. Cement will be from 6900'-6500'. Collect wet and dry samples of cement to be left on rig. RD Cementers.
14. Pull out of cement at a rate of 1 jt/min. TOOH and SB 4065' of 2-3/8" tbq. LD remaining tbq.
15. MIRU WL. PU and RIH with two 3-1/8" perf guns with 3 spf, min 0.5" EHD, 120° phasing. Shoot 2' of squeeze holes at 4410' and 4' of squeeze holes at 4005'. RDMO WL.
16. PU and TIH with (4-1/2", 11.6#) CICR on 2-3/8" tbq. Set CICR at 4065'.
17. Establish circulation to surface with biocide treated fresh water, and pump 100 bbls to clean up hole.
18. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump Sussex Squeeze: 110 sx (35.1 bbl or 197 cf) with TXI cement 0.25 lb/sk polyflake, assuming 12 ppg & 1.79 cf/sk. Max pump pressure at surface is to be 706 psi. Underdisplace by 3 bbls. Volume is based on 345' below the CICR inside 4-1/2", 11.6# production casing with no excess, 405' in the 4-1/2", 11.6# annulus assuming 7.88" bit size with 60% excess and 160' on top of the CICR to cover top perfs. Collect wet and dry samples of cement to be left on rig. RD Cementers.

19. Pull out of cement at a rate of 1 jt/min. TOO H to 3375'. Reverse circulate to ensure no cement is left in the tbg.
20. TOO H and SB 1055' of 2-3/8" tbg. LD stinger, and remaining tbg.
21. MIRU WL. RIH and jet cut 4-1/2", 11.6# casing at 955'. RDMO WL.
22. Attempt to establish circulation and circulate (77 bbl) with fresh water containing biocide to remove any gas.
23. ND BOP. ND TH. Un-land casing using a casing spear, not a lifting sub. Rig max pull shall be 100,000#. Max pull over string weight shall be 50,000#. If unable to unland, contact Engineering.
24. Install BOP on casing head with 4-1/2", 11.6# pipe rams.
25. TOO H and LD all 4-1/2", 11.6# casing. Remove 4-1/2", 11.6# pipe rams and install 2-3/8" pipe rams.
26. TIH with mule shoe and 2-3/8" tubing to 1055'.
27. Establish circulation to surface with biocide treated fresh water and pump at least three hole-volumes (235.5 bbl) to circulate all gas out of the well. Contact engineering if evidence of gas migration persists.
28. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump Stub Plug: 180 sx (49.7 bbl or 279 cf) cement with 0.25 lb/sk Polyflake, assuming 14 ppg & 1.55 cf/sk. Volume is based on 100' in 4-1/2", 11.6# production casing with no excess, 280' in 7.88" bit size with 100% excess factor, and 200' in the 8-5/8", 24# surface casing with no excess. The plug is designed to cover 1055'-475'. Collect wet and dry samples of cement to be left on rig. RDMO Cementers. Notify engineering if circulation is ever lost during job.
29. Pull out of cement at a rate of 1 jt/min and TOO H to 100'. Reverse circulate using biocide treated fresh water to ensure the tubing is clean. TOO H, LD all 2-3/8" tbg.
30. Tag cement as needed. After tagging top of cement, and verifying appropriate coverage above the surface casing shoe, pressure test surface casing to 500 psi and hold for 15 minutes.
31. MIRU WL. RIH 8-5/8", 24# CIBP to 80'. RDMO WL and WO rig.
32. Instruct cementing and wireline contractors to e-mail copies of all job logs/job summaries to rscDJVendors@anadarko.com within 24 hours of completion of the job.
33. Supervisor submit paper copies of all invoices, logs, and reports to VWP Engineering Specialist.
34. Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.
35. Capping crew will set and secure night cap on 8-5/8", 24# casing head, restrain the casing head, pressure test CIBP to 500 psi with hydrotest pump, then remove night cap and casing head restraints.
36. Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
37. Welder cut casing minimum 5' below ground level.
38. Fill casing to surface using 4500 psi compressive strength cement (NO gravel).
39. Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
40. Obtain GPS location data as per COGCC Rule 215 and send to rscDJVendors@anadarko.com.
41. Properly abandon flow lines per Rule 1103. File electronic Form 42 once abandonment is complete.
42. Back fill hole with fill. Clean location, and level.
43. Submit Form 6 to COGCC ensuring to provide 'As performed' WBD identifying operations completed.