

Engineer: Clark Martin  
Cell Phone Number: 970-371-4601

## PLUG and ABANDONMENT PROCEDURE

### DORIS SMITH & CO. 41D-21 1

#### Description

1. Provide 48 hour notice to COGCC prior to rig up per request on approved Form 6 (e.g. call field coordinator, submit Form 42, etc.). Notify Automation Removal Group at least 24 hours prior to rig move. Request they catch and remove plunger, isolate production equipment, and remove any automation prior to rig MIRU.
2. Prepare location for base beam equipped rig. Install perimeter fence as needed.
3. Verify COAs before RU.
4. Upon RU, check and record bradenhead pressure. If bradenhead valve is not accessible, re-plumb so that valve is above GL. Blow down bradenhead and re-check pressure the next day. Repeat until pressure stays at 0 psi.
5. MIRU WO rig. Spot a tbg trailer. LOTO Pumping Unit. Kill well as necessary using biocide treated fresh water. ND WH. NU BOP.
6. Unhang rods from pumping unit bridle. ND WH. NU BOP. TOOH and LD rod string.
7. MIRU Slickline and VES. WELL NEEDS GYRO RUN. Run gyro to 4735', making stops every 100'. RDMO Slickline and VES.
8. Unland tbg using unlanding joint and LD. Release tbg anchor. TOOH and SB 4600' 2-3/8" tbg. LD tbg anchor, pump and any remaining tbg.
9. PU and TIH with (5-1/2", 15.5#) Bit and Scraper on 2-3/8" tbg to 4610'. TOOH, SB all 2-3/8" tbg. LD Bit and Scraper.
10. MIRU WL. PU and RIH with (5-1/2", 15.5#) CIBP and set at +/- 4600'. POOH. RDMO WL.
11. TIH with 2-3/8" tbg to 4600' Load hole with biocide treated fresh water and circulate all gas out of well. TOOH and SB 2-3/8" tbg.
12. MIRU WL. RIH and run CBL from 4600' to surface. Forward CBL to Platteville office. Cementing plans may change depending on CBL results. RDMO WL. TIH with 2-3/8" tbg to 4600'. PT CIBP to 1000psi for 15 minutes.
13. MIRU Cementers. Pump Sussex Balance Plug: Pump 40 sx (11 bbl or 62 cf), assuming 15.8 ppg & 1.53 cf/sk. Volume based on 400' inside 5-1/2", 15.5# production casing with no excess. Cement will be from 4600'-4200'. RD Cementers.
14. Slowly pull out of the cement and TOOH. Reverse circulate using biocide treated fresh water to ensure the tubing is clean. TOOH, SB 1600' 2-3/8" tbg. LD remaining tbg.
15. MIRU WL. RIH and jet cut 5-1/2", 15.5# casing at 480'. RDMO WL.
16. Attempt to establish circulation and circulate (46 bbl) with fresh water containing biocide to remove any gas.
17. ND BOP. ND TH. Un-land casing using a casing spear, not a lifting sub. Rig max pull shall be 100,000#. Max pull over string weight shall be 50,000#. If unable to unland, contact Engineering.
18. Install BOP on casing head with 5-1/2", 15.5# pipe rams.
19. TOOH and LD all 5-1/2", 15.5# casing. Remove 5-1/2", 15.5# pipe rams and install 2-3/8" pipe rams.
20. TIH with mule shoe and 2-3/8" tubing to 1600'.

21. Establish circulation to surface with biocide treated fresh water and pump at least two hole-volumes (145 bbl) to circulate all gas out of the well. Contact engineering if evidence of gas migration persists.
22. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump Stub Plug: 260 sx (71.8 bbl or 403 cf) CLASS G cement with 0.25 lb/sk Polyflake, assuming 14 ppg & 1.55 cf/sk. Volume is based on 1120' in 5-1/2", 15.5# production casing with no excess, 263' in 7.88" bit size with 100% excess factor, and 202' in the 8-5/8", 24# surface casing with no excess. The plug is designed to cover 1600'-15'. RDMO Cementers. Notify engineering if circulation is ever lost during job.\*\*\*Contact Engineering before pumping. This plug will be split into two plugs
23. Slowly pull out of the cement and TOO H to 100'. Reverse circulate using biocide treated fresh water to ensure the tubing is clean. TOO H, LD all 2-3/8" tbgs.
24. Tag cement as needed. After tagging top of cement, and verifying appropriate coverage above the surface casing shoe, pressure test surface casing to 500 psi and hold for 15 minutes.
25. MIRU WL. RIH 8-5/8", 24# CIBP to 80'. RDMO WL and WO rig.
26. Instruct cementing and wireline contractors to e-mail copies of all job logs/job summaries to [rscDJVendors@anadarko.com](mailto:rscDJVendors@anadarko.com) within 24 hours of completion of the job.
27. Supervisor submit paper copies of all invoices, logs, and reports to VWP Engineering Specialist.
28. Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.
29. Capping crew will set and secure night cap on 8-5/8", 24# casing head, restrain the casing head, pressure test CIBP to 500 psi with hydrotest pump, then remove night cap and casing head restraints.
30. Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
31. Welder cut casing minimum 5' below ground level.
32. Fill casing to surface using 4500 psi compressive strength cement (NO gravel).
33. Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
34. Obtain GPS location data as per COGCC Rule 215 and send to [rscDJVendors@anadarko.com](mailto:rscDJVendors@anadarko.com).
35. Properly abandon flow lines per Rule 1103. File electronic Form 42 once abandonment is complete.
36. Back fill hole with fill. Clean location, and level.
37. Submit Form 6 to COGCC ensuring to provide 'As performed' WBD identifying operations completed.