

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Document Number:
401724723
Date Received:
08/06/2018

FIR RESOLUTION FORM

CA Summary:
4 of 6 CAs from the FIR responded to on this Form
4 CA Completed
0 Factual Review Request

OPERATOR INFORMATION

OGCC Operator Number: 10112
Name of Operator: FOUNDATION ENERGY MANAGEMENT LLC
Address: 5057 KELLER SPRINGS RD STE 650
City: ADDISON State: TX Zip: 75001
Contact Name and Telephone:
Name:
Phone: () Fax: ()
Email:

Additional Operator Contact:

Contact Name Phone Email
Alyssa Beard 303-244-8114 abeard@foundationenergy.com

COGCC INSPECTION SUMMARY:

FIR Document Number: 691200304
Inspection Date: 07/27/2018 FIR Submit Date: 07/27/2018 FIR Status:

Inspected Operator Information:

Company Name: FOUNDATION ENERGY MANAGEMENT LLC Company Number: 10112
Address: 5057 KELLER SPRINGS RD STE 650
City: ADDISON State: TX Zip: 75001

LOCATION - Location ID: 331181

Location Name: FEDERAL OSPREY-68N60W Number: 35NENW County:
Qtrqtr: NENW Sec: 35 Twp: 8N Range: 60W Meridian: 6
Latitude: 40.622480 Longitude: -104.061270

FACILITY - API Number: 05-123-00 Facility ID: 331181

Facility Name: FEDERAL OSPREY-68N60W Number: 35NENW
Qtrqtr: NENW Sec: 35 Twp: 8N Range: 60W Meridian: 6
Latitude: 40.622480 Longitude: -104.061270

CORRECTIVE ACTIONS:

1 CA# 117694
Corrective Action: Comply w/ Rule 605.a.(4) Date: 11/03/2016

Response: CA COMPLETED Date of Completion: 08/03/2018

Operator Comment: Berms have been repaired

COGCC Decision: Approved

COGCC Representative: _____

3 CA# 117696

Corrective Action: Comply w/ Rule 605.d.

Date: 11/03/2016

Response: CA COMPLETED

Date of Completion: 08/03/2018

Operator Comment: Stained soil at pumpjack/skid removed

COGCC Decision: Approved

COGCC Representative: _____

4 CA# 117697

Corrective Action: Comply w/ Rule 605.d.

Date: 11/03/2016

Response: CA COMPLETED

Date of Completion: 08/03/2018

Operator Comment: Stained soil at treater removed. Tubing and rods were recently pulled while Mallard Exploration frac'd a new well due south of the Osprey. Tubing and rods will be run back in shortly.

COGCC Decision: Approved

COGCC Representative: _____

5 CA# 117698

Corrective Action: Comply w/ Rule 605.d.

Date: 11/03/2016

Response: CA COMPLETED

Date of Completion: 08/03/2018

Operator Comment: Stained soil at engine removed

COGCC Decision: Approved

COGCC Representative: _____

OPERATOR COMMENT AND SUBMITTAL

Comment: Berms have been repaired and stained soil in various places has been removed. The tubing and rods were on location due to recent work to protect the producing zone in this well while the new Mallard Exploration well was frac'd directly south. The Osprey well is scheduled to be put back online in the next few weeks.

I hereby certify that the statements made in this form are, to the best of my knowledge, true, correct, and complete.

Print Name: Bonita Harris

Signed: _____

Title: HSE/Regulatory Tech

Date: 8/6/2018 10:05:29 AM

ATTACHMENT LIST

View Attachments in Imaged Documents on COGCC website (<http://ogccweblink.state.co.us/>) - Search by Document Number.

Document Number **Description**

401724723	FIR RESOLUTION SUBMITTED
-----------	--------------------------

401724726	Berms/Rule 605.a.
401724727	Stained soil at engine removed/Rule 605.d.
401724728	Stained soil at treater removed/Rule 605.d.
401724729	Stained soil at treater removed/Rule 605.d.
401724730	Berms/load out/Rule 605.a.
401724731	Stained soil at wellhead removed/Rule 605.d.
401724733	Berms/load out/Rule 605.a.
401724734	Stained soil near engine removed/Rule 605.d.
401724735	Stained soil near engine removed/Rule 605.d.

Total Attach: 10 Files