



STATE OF COLORADO

EnviroScan - DNR, OGCC <dnr_ogcc.enviroscan@state.co.us>

API# 121-05603
Loc# 316965
Doc# 2303008
Date: 09/20/18

State 3 (API 121-05603, Loc ID 316965)

1 message

Deranleau - DNR, Greg <greg.deranleau@state.co.us>

Thu, Sep 20, 2018 at 2:36 PM

To: Randy Ward <randy@wardoil.com>

Cc: Rob Young <rob.young@state.co.us>, Diana Burn <Diana.Burn@state.co.us>, "Freese, Steve" <steve.freese@state.co.us>

Randy,

In follow up to our conversation today, please submit a Form 4 to complete the down hole work that you indicated (cemented 4-1/2" liner). Additionally, based on the photos provided by Steve Freese at SLB, and your description that fluid keeps flowing into the hole despite a downhole packer, in accordance with Rule 906, this spill should be reported on a Form 19; please submit as soon as possible--it should have been reported as a spill as soon as the volume reached 1 bbl. COGCC wants to make sure the source is identified and stopped and that any impacts are fully delineated and cleaned up in accordance with the 900-Series Rules.

Lastly, when COGCC inspected this well on February 8, 2018, there appeared to be new gravel or fill dirt placed around the wellhead. Can you please describe the work that was done prior to that inspection--is that the excavation to investigate a possible flowline spill that you indicated when we spoke today? Has additional work been done since then?

Thanks for your cooperation.

Greg

--

Greg Deranleau

Environmental Manager



P 303.894.2100 x5153

1120 Lincoln Street, Suite 801, Denver, CO 80203

greg.deranleau@state.co.us | www.colorado.gov/cogcc

Cc: API 121-05603 & Location ID 316965: "CORRESPONDENCE TO WARD" 9/20/18

Attachment: API 121-05603 & Location ID 316965 "WELLHEAD PHOTO FROM SLB" 9/11/18



Ward & Son - State 3 121-05603.jpg
3183K