

Engineer: Clark Martin
Cell Phone Number: 970-371-4601

PLUG and ABANDONMENT PROCEDURE

MATHEWS 2

Description

1. Provide 48 hour notice to COGCC prior to rig up per request on approved Form 6 (e.g. call field coordinator, submit Form 42, etc.). Notify Automation Removal Group at least 24 hours prior to rig move. Request they catch and remove plunger, isolate production equipment, and remove any automation prior to rig MIRU.
2. MIRU Slickline. Pull production equipment and tag bottom. Record tag depth in Open Wells. Gyro was run on 11/04/14. RDMO Slickline.
3. Prepare location for base beam equipped rig. Install perimeter fence as needed.
4. Verify COAs before RU.
5. Upon RU, check and record bradenhead pressure. If bradenhead valve is not accessible, re-plumb so that valve is above GL. Blow down bradenhead and re-check pressure the next day. Repeat until pressure stays at 0 psi.
6. MIRU WO rig. Kill well as necessary using biocide treated fresh water. ND WH. NU BOP. Pressure Test BOP per company guidelines. Unland tbg using unlanding joint and LD.
7. TOOH and SB 7200' 1.9", 2.75# tbg. LD any remainder.
8. MIRU WL. PU and RIH with (2-7/8", 6.5#) gauge ring to 8010'. POOH.
9. PU and RIH with (2-7/8", 6.5#) CIBP and set at +/- 8000'. POOH. RIH and dump 2 sx cement on CIBP. POOH.
10. PU and RIH with (2-7/8", 6.5#) CIBP and set at +/- 7200'. POOH. RDMO WL.
11. TIH with 1.9", 2.75# tbg to 7200' Load hole with biocide treated fresh water and circulate all gas out of well. TOOH and SB 1.9", 2.75# tbg.
12. MIRU WL. RIH and run CBL from 7200' to surface to determine TOC in liner and determine liner cutting depth. Forward CBL to Platteville office. Cementing plans may change depending on CBL results. RDMO WL. TIH with 1.9", 2.75# tbg to 7200'. PT CIBP to 1000psi for 15 minutes.
13. MIRU Cementers. Pump Niobrara Balance Plug: Pump 10 sx (2.8 bbl or 16 cf), assuming 15.8 ppg & 1.53 cf/sk. Volume based on 400' inside 2-7/8", 6.5# production casing with no excess. Cement will be from 7200'-6800'. Collect wet and dry samples of cement to be left on rig. RD Cementers.
14. Pull out of cement at a rate of 1 jt/min. TOOH, LD ALL 1.9", 2.75# tbg.
15. MIRU WL. RIH and jet cut 2-7/8", 6.5# casing at 4770'. RDMO WL.
16. Attempt to establish circulation to surface with biocide treated fresh water and pump at least two hole-volume (244 bbl) to circulate all gas out of the well and cleanup hole. Contact engineering if evidence of gas migration persists.
17. ND BOP. ND TH. Un-land casing using a casing spear, not a lifting sub. Rig max pull shall be 100,000#. Max pull over string weight shall be 50,000#. If unable to unland, contact Engineering. SB 1800' 2-7/8", 6.5# csg. **May need slip type elevators for nonupset cuppling.
18. MIRU WL. PU and RIH with (4.5", 15.1#) gauge ring to 4600'. POOH.
19. PU and RIH with (4-1/2", 15.1#) CIBP and set at +/- 4580'. POOH.

20. RIH and run CBL from 4580' to surface to determine TOC in casing and determine casing cut. Forward CBL to Platteville office. Cementing plans may change depending on CBL results.
21. RIH and dump 2 sx cement on CIBP. POOH.
22. RIH and jet cut 4-1/2", 15.1# casing at 1180'. RDMO WL.
23. Attempt to establish circulation and circulate (100 bbl) with fresh water containing biocide to remove any gas.
24. ND BOP. ND TH. Un-land casing using a casing spear, not a lifting sub. Rig max pull shall be 100,000#. Max pull over string weight shall be 50,000#. If unable to unland, contact Engineering.
25. Install BOP on casing head with 4-1/2", 15.1# pipe rams.
26. TOOH and LD all 4-1/2", 12.6# casing. Remove 4-1/2", 15.1# pipe rams and install 2-7/8" 6.5# rams.
27. TIH with mule shoe and 2-7/8" 6.5# tubing to 1800'.
28. Establish circulation to surface with biocide treated fresh water and pump at least two hole-volumes (266 bbl) to circulate all gas out of the well. Contact engineering if evidence of gas migration persists.
29. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump Stub Plug: 460 sx (127 bbl or 713 cf) Class G cement with 0.25 lb/sk Polyflake, assuming 14 ppg & 1.55 cf/sk. Volume is based on 620' in 4-1/2", 12.6# production casing with no excess. 853' in 7.88" bit size open hole with 100% excess factor. 202' in the 8-5/8", 24# surface casing with no excess. The plug is designed to cover 1800'-125'. Collect wet and dry samples of cement to be left on rig. RDMO Cementers. Notify engineering if circulation is ever lost during job. **Plug will likely be a 2-3 stage. Contact engineering before pumping.
30. Pull out of cement at a rate of 1 jt/min. TOOH to 100'. Reverse circulate using biocide treated fresh water to ensure the tubing is clean. TOOH, LD all 2-7/8" 6.5# tbg.
31. Tag cement as needed. After tagging top of cement, and verifying appropriate coverage above the surface casing shoe, pressure test surface casing to 500 psi and hold for 15 minutes.
32. MIRU WL. RIH 8-5/8", 24# CIBP to 80'. RDMO WL and WO rig.
33. Instruct cementing and wireline contractors to e-mail copies of all job logs/job summaries to rscDJVendors@anadarko.com within 24 hours of completion of the job.
34. Supervisor submit paper copies of all invoices, logs, and reports to VWP Engineering Specialist.
35. Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.
36. Capping crew will set and secure night cap on 8-5/8", 24# casing head, restrain the casing head, pressure test CIBP to 500 psi with hydrotest pump, then remove night cap and casing head restraints.
37. Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
38. Welder cut casing minimum 5' below ground level.
39. Fill casing to surface using 4500 psi compressive strength cement (NO gravel).
40. Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
41. Obtain GPS location data as per COGCC Rule 215 and send to rscDJVendors@anadarko.com.
42. Properly abandon flow lines per Rule 1103. File electronic Form 42 once abandonment is complete.
43. Back fill hole with fill. Clean location, and level.
44. Submit Form 6 to COGCC ensuring to provide 'As performed' WBD identifying operations completed.