

FORM
6Rev
05/18

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401782787

Date Received:

10/03/2018

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: AJ Paine

Name of Operator: NOBLE ENERGY INC

Phone: (406) 671-4612

Address: 1001 NOBLE ENERGY WAY

Fax:

City: HOUSTON State: TX Zip: 77070

Email: aj.paine@nblenergy.com

For "Intent" 24 hour notice required,

Name: Silver, Randy

Tel: (720) 827-6688

COGCC contact:

Email: randy.silver@state.co.us

API Number 05-123-16416-00

Well Name: KATE WHITE

Well Number: D 29-7

Location: QtrQtr: SWNE Section: 29 Township: 3N Range: 64W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.197970

Longitude: -104.571860

GPS Data:

Date of Measurement: 09/22/2006

PDOP Reading: 1.9

GPS Instrument Operator's Name: Paul Tappy

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 773

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6994	7008			
NIOBRARA	6687	6772			
SUSSEX	4407	4438	05/20/2004	SQUEEZED	

Total: 3 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	561	390	561	0	VISU
1ST	7+7/8	4+1/2	11.6	7,155	240	7,155	6,145	CBL
S.C. 1.1				7,155	430	4,880	3,770	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6637 with 20 sacks cmt on top. CIPB #2: Depth 4357 with 20 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIPB #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____	sks cmt from _____	ft. to _____	ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____	sks cmt from _____	ft. to _____	ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____	sks cmt from _____	ft. to _____	ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____	sks cmt from _____	ft. to _____	ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____	sks cmt from _____	ft. to _____	ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>

Perforate and squeeze at 2500 ft. with 165 sacks. Leave at least 100 ft. in casing 2400 CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 260 sacks half in. half out surface casing from 823 ft. to 0 ft. Plug Tagged: ☒

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Plugging Date: _____
of _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Stephanie Dionne

Title: Engineering Tech Date: 10/3/2018 Email: stephanie.dionne@nblenergy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Jacobson, Eric Date: 10/19/2018

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: 4/18/2019

COA Type	Description
	<p>If there has not been a reported Bradenhead test within 60 days of plugging this well, prior to starting plugging operations, a Bradenhead test shall be performed.</p> <p>1) If, before opening the Bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>3) If sampling is required contact COGCC engineering for an confirmation of plugging requirements prior to placing any plugs.</p> <p>Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions.</p> <p>The Form 17 shall be submitted within 10 days of the test.</p>
	<p>1) Provide 48 hour notice of plugging MIRU via electronic Form 42.</p> <p>2) Prior to placing the 823' plug: verify that all fluid migration (liquid or gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>3) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 511' or shallower and provide 10 sack plug at surface.</p> <p>4) Leave at least 100' of cement in the wellbore for each plug.</p> <p>5) Properly abandon on-location flowlines as per Rule 1105. File electronic Form 42 once abandonment is complete. Within 30 days of an operator completing abandonment requirements for an off-location flowline or crude oil transfer line, the operator must submit a Flowline Report, Form 44.</p>
	Operator shall implement measures to control unnecessary and excessive venting, to protect the health and safety of the public, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.
	Operator shall submit a Form 7 Monthly Report of Operations to correct the NBRR formation from 1999 to July 2004, and to add missing reporting for the month of Sept 2015, as required for compliance with Rule 309, within 30 days (due 11/19/2018).

Attachment Check List

Att Doc Num	Name
401782787	FORM 6 INTENT SUBMITTED
401782816	WELLBORE DIAGRAM
401782820	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

User Group	Comment	Comment Date
Engineer	Deepest Water Well within 1 Mile – 65' SB5 Base of Fox Hills - 564'	10/19/2018
Well File Verification	Pass	10/04/2018
Permit	<p>Verified as-drilled lat/longs.</p> <p>Form 5 (doc #612366, 9/14/1993); CODL perf interval 6994-7008'.</p> <p>Form 5 (doc #612362, 9/26/1996); perf intervals 4407-4438 (SUSX), 6687-6772 (NBRR), 6994-7008 (CODL).</p> <p>Form 5A (doc #1208837, 9/10/2004); reperf CODL (6995-7007'), abandon SUSX (squeeze, no depth given).</p> <p>Form 7 production reporting missing NBRR formation from 1st production in 1996 until July 2004; missing Sept 2015.</p>	10/03/2018

Total: 3 comment(s)