

Document Number:
401814497

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Valerie Danson
 Name of Operator: PDC ENERGY INC Phone: (970) 506-9272
 Address: 1775 SHERMAN STREET - STE 3000 Fax: _____
 City: DENVER State: CO Zip: 80203 Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required, Name: Montoya, John Tel: (970) 397-4124
 COGCC contact: Email: john.montoya@state.co.us

API Number 05-123-14124-00 Well Number: 29-1
 Well Name: CARLSON
 Location: QtrQtr: SWNE Section: 29 Township: 5N Range: 64W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: 68980
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.371667 Longitude: -104.571111
 GPS Data:
 Date of Measurement: 05/12/2010 PDOP Reading: 2.7 GPS Instrument Operator's Name: Chuck Kraft
 Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: 1600
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA	6620	6792			
CODELL	6880	6896	07/26/2006	B PLUG CEMENT TOP	6865

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	313	220	313	0	VISU
1ST	7+7/8	3+1/2	10.3	6,972	220	6,972	6,332	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6570 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 250 sks cmt from 1715 ft. to 1300 ft. Plug Type: STUB PLUG Plug Tagged:
 Set 330 sks cmt from 513 ft. to 0 ft. Plug Type: OPEN HOLE Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at 4700 ft. with 248 sacks. Leave at least 100 ft. in casing 4215 CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 (Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged:
 Set _____ sacks at surface
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
 Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Plugging Date: _____
 of _____
 *Wireline Contractor: _____ *Cementing Contractor: _____
 Type of Cement and Additives Used: _____
 Flowline/Pipeline has been abandoned per Rule 1105 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Carlson 29-1 (05-123-14124)/Plugging Procedure (Intent)
 Producing Formation: Codell: 6880'-6896' Niobrara: 6620'-6792'
 Upper Pierre Aquifer: 400'-1421'
 TD: 7005' PBTD: 6818.1'
 Surface Casing: 8 5/8" 24# @ 313' w/ 220 sxs
 Production Casing: 3 1/2" 10.3# @ 6972' w/ 220 sxs cmt (TOC @ 6332' - CBL).
 Existing CIBP @ 6865' w 1 sxs cmt (7/26/2006).

Tubing: 1 1/2" tubing set @ 6658.4' (1/17/2013).
 Proposed Procedure:
 1. MIRU pulling unit. Pull 1 1/2" tubing.
 2. RU wireline company.
 3. TIH with CIBP. Set BP at 6570'. Top with 2 sxs 15.8#/gal CI G cement.
 4. TIH with perf gun. Shoot lower squeeze holes at 4700' and shoot upper squeeze holes at 4200' for Sussex coverage.
 5. Set CICR at 4215'. RU cementing company. Sting in and pump 238 sxs 15.8#/gal CI G cement. Sting out and pump 10 sxs on top of CICR.
 6. TIH with casing cutter. Cut 3 1/2" casing at 1600'. Pull cut casing.
 7. TIH with tubing to 1715'. Mix and pump 250 sxs 15.8#/gal CI G cement w/ 2% CaCl down tubing (Pierre aquifer coverage from 1715'-1300').
 8. Pick up tubing to 513'. Mix and pump 330 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
 9. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Valerie Danson

Title: Reg Tech

Date:

Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

COA Type	Description

Attachment Check List

Att Doc Num	Name
401814682	WELLBORE DIAGRAM
401814684	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group	Comment	Comment Date
		Stamp Upon Approval

Total: 0 comment(s)