

SUMMARY P&A PROCEDURE

HRM RESOURCES, LLC

G KUYKENDALL #10

API# 05-081-06661

NWNW SECTION 27-T12N-R100W

MOFFAT COUNTY, CO

PROCEDURE

Notify COGCC via Form 6 of Intent to P&A and Form 42; notify landowner prior to MIRU.

Blow down well and MIRU workover rig. Trip out all tubing.

MIRU wireline, Run CBL to verify calculated cmt top.

Set CIBP at 4522' w/ 2 sx on top. Load hole and test to 500 psi to verify casing integrity.

Shoot squeeze holes at 2400', and set CICR @ 2350'.

Cement 40 sx cmt through CICR leaving another 10 sx cmt on top.

Shoot squeeze holes at 400', cement 80 sx to surface in 5 ½ casing & 9 5/8" annulus.

Flush, cut off and cap WH and flowline.