

Inspection Photos

11/19/2018

Operator: FOUNDATION ENERGY
MANAGEMENT LLC - 10112

Location ID: 327492

Inspection Doc. Number: 682504195
Weld County, CO

Aaron Trujillo
NE Reclamation Specialist
COGCC

Inspection Photos
Operator: FOUNDATION ENERGY MANAGEMENT LLC - 10112
Location ID: 327492



Photo 1: Photo taken from the north end of the location. Photos 1-3 provide an overview of the location from east, to south, to west. Photos also show that additional reclamation appears to have been conducted, however reclamation does not appear to have been conducted in accordance with 1000 reclamation requirements; 1004.a requires compaction alleviation to be conducted by cross-ripping to a depth of 18 inches. Location has not been cross-ripped. Compaction concerns remain evident.



Photo 2: See Comments under photo 1.



Photo 3: See Comments under photo 1.



Photo 4: Photo taken from the location, facing south. Photo shows location appears to have been ripped in one direction. 1004.a requires compaction alleviation to be conducted by cross-ripping to a depth of 18 inches. Location has not been cross-ripped. Compaction concerns remain evident.

Inspection Photos
Operator: FOUNDATION ENERGY MANAGEMENT LLC - 10112
Location ID: 327492



Photo 5: Photo taken from the north end of the location, facing north. Photo shows access road. Unable to find evidence that compaction alleviation has been conducted in accordance with 1004.a



Photo 6: Photo taken from the access road, facing north. Photo shows access road. Unable to find evidence that compaction alleviation has been conducted in accordance with 1004.a. Access road also does not appear to have been re-contoured or re-graded.



Photo 7: Photo taken from the access road, facing north. Photo shows access road. Unable to find evidence that compaction alleviation has been conducted in accordance with 1004.a. Access road also does not appear to have been re-contoured or re-graded. Photo also shows erosion degradation on road.



Photo 8: Photo taken from the access road, facing south. Photo shows inspector tested the access road for compaction. Photo shows inspector was only able to penetrate the top inch of soil on the access road. Compaction concerns evident.



Photo 9: Photo taken from the adjacent reference area. Photo shows inspector was able to easily penetrate the top 6-8 inches of soil.



Photo 10: Photo taken from the location, facing south. Photo shows inspector tested the location for compaction. Photo shows inspector was only able to penetrate the top couple of inches of soil on the areas of location that were not ripped. Compaction concerns evident.