

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Document Number:
401778160
Date Received:
09/28/2018

FIR RESOLUTION FORM

CA Summary:

1 of 1 CAs from the FIR responded to on this Form

1 CA Completed
0 Factual Review Request

OPERATOR INFORMATION

OGCC Operator Number: 47120
Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP
Address: P O BOX 173779
City: DENVER State: CO Zip: 80217-3779
Contact Name and Telephone:
Name: _____
Phone: () _____ Fax: () _____
Email: _____

Additional Operator Contact:

Contact Name	Phone	Email
Luke Reddy	970-515-1292	luke.reddy@anadarko.com

COGCC INSPECTION SUMMARY:

FIR Document Number: 690002409
Inspection Date: 09/14/2018 FIR Submit Date: 09/14/2018 FIR Status: _____

Inspected Operator Information:

Company Name: KERR MCGEE OIL & GAS ONSHORE LP Company Number: 47120
Address: P O BOX 173779
City: DENVER State: CO Zip: 80217-3779

LOCATION - Location ID: 306375

Location Name: CAMP-63N66W Number: 26SWNE County: _____
Qtrqtr: SWNE Sec: 26 Twp: 3N Range: 66W Meridian: 6
Latitude: 40.199650 Longitude: -104.743650

FACILITY - API Number: 05-123-00 Facility ID: 306375

Facility Name: CAMP-63N66W Number: 26SWNE
Qtrqtr: SWNE Sec: 26 Twp: 3N Range: 66W Meridian: 6
Latitude: 40.199650 Longitude: -104.743650

CORRECTIVE ACTIONS:

1 ☒ CA# 118723

Corrective Action: Request Bradenhead Test and Resolution Plan submission to COGCC Engineering department.

Date: 09/24/2018

Response: CA COMPLETED

Date of Completion: 09/21/2018

Operator Comment: The well was inspected and it was determined that the packoff rubber on the surface casing head was not sealed and found to have 70# on it. Land clearance was granted to set a temporary 500 bbl tank, and blew down the surface casing to 0 psi. The pressure stayed at 0 for 30 minutes. The cap was removed from the surface casing head and the bottom plates, packoff rubber, and top plates were replaced and pressure tested the surface head to 90 psi to ensure the leak is fixed.
An email was sent to COGCC engineering as requested.

COGCC Decision: Approved

COGCC
Representative:

OPERATOR COMMENT AND SUBMITTAL

Comment: The well was inspected and it was determined that the packoff rubber on the surface casing head was not sealed and found to have 70# on it. Land clearance was granted to set a temporary 500 bbl tank, and blew down the surface casing to 0 psi. The pressure stayed at 0 for 30 minutes. The cap was removed from the surface casing head and the bottom plates, packoff rubber, and top plates were replaced and pressure tested the surface head to 90 psi to ensure the leak is fixed.
An email was sent to COGCC engineering as requested.

I hereby certify that the statements made in this form are, to the best of my knowledge, true, correct, and complete.

Print Name: Luke Reddy

Signed: _____

Title: Regulatory Specialist

Date: 9/28/2018 12:54:20 PM

ATTACHMENT LIST

View Attachments in Imaged Documents on COGCC website (<http://ogccweblink.state.co.us/>) - Search by Document Number.

Document Number Description

401778160	FIR RESOLUTION SUBMITTED
-----------	--------------------------

Total Attach: 1 Files