

FORM  
6Rev  
05/18

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401912426

Date Received:

01/21/2019

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: AJ Paine

Name of Operator: NOBLE ENERGY INC

Phone: (406) 671-4612

Address: 1001 NOBLE ENERGY WAY

Fax:

City: HOUSTON State: TX Zip: 77070

Email: aj.paine@nblenergy.com

For "Intent" 24 hour notice required,

Name: Silver, Randy

Tel: (720) 827-6688

COGCC contact:

Email: randy.silver@state.co.us

API Number 05-123-17008-00

Well Name: CAMOLO RED

Well Number: D 27-6

Location: QtrQtr: SENW Section: 27 Township: 3N Range: 64W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.198400

Longitude: -104.539900

GPS Data:

Date of Measurement: 09/22/2006

PDOP Reading: 2.0

GPS Instrument Operator's Name: Paul Tappy

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 867

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7026	7038			
SUSSEX	4435	4477	05/15/2006	SQUEEZED	

Total: 2 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	653	460	653	13	VISU
1ST	7+7/8	3+1/2	7.70	7,177	187	7,177	6,035	CBL
S.C. 1.1				4,696	385	4,696	3,920	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6976 with 20 sacks cmt on top. CIBP #2: Depth 4385 with 2 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 20 sks cmt from 6976 ft. to 6500 ft. Plug Type: CASING Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 2500 ft. with 180 sacks. Leave at least 100 ft. in casing 2400 CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 300 sacks half in. half out surface casing from 917 ft. to 0 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
of \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Diane Blair

Title: Operations Technician Date: 1/21/2019 Email: diane.blair@nblenergy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Jacobson, Eric Date: 1/28/2019

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: 7/27/2019

<b>COA Type</b>	<b>Description</b>
	<p>If there has not been a reported Bradenhead test within 60 days of plugging this well, prior to starting plugging operations, a Bradenhead test shall be performed.</p> <p>1) If, before opening the Bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>3) If sampling is required contact COGCC engineering for an confirmation of plugging requirements prior to placing any plugs.</p> <p>Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions.</p> <p>The Form 17 shall be submitted within 10 days of the test.</p>
	<p>1) Provide 48 hour notice of plugging MIRU via electronic Form 42.</p> <p>2) Prior to placing the 917' plug: verify that all fluid migration (liquid or gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>3) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 603' or shallower and provide 10 sack plug at surface.</p> <p>4) Leave at least 100' of cement in the wellbore for each plug.</p> <p>5) Properly abandon on-location flowlines as per Rule 1105. File electronic Form 42 once abandonment is complete. Within 30 days of an operator completing abandonment requirements for an off-location flowline or crude oil transfer line, the operator must submit a Flowline Report, Form 44.</p>
	Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.
	<p>Submit Operator's Monthly Production Reports (Form 7) required for compliance with Rule 309 within 30 days</p> <p>-Sussex production needs fixed from 6/2006-2/2009</p> <p>-Missing production from 11/2004</p>

### **Attachment Check List**

<b><u>Att Doc Num</u></b>	<b><u>Name</u></b>
401912426	FORM 6 INTENT SUBMITTED
401912438	WELLBORE DIAGRAM
401912441	WELLBORE DIAGRAM

Total Attach: 3 Files

### **General Comments**

<b><u>User Group</u></b>	<b><u>Comment</u></b>	<b><u>Comment Date</u></b>
Engineer	<p>Deepest Water Well within 1 Mile – 276' SB5 Base of Fox Hills - 694'</p> <p>Production records indicate this well has been SI since December 2015. All shut-in wells must pass a mechanical integrity test or be plugged and abandoned within two years of the initial shut-in date, this form 6 intent does not extend that due date.</p>	01/28/2019
Permit	<p>Verified as drilled lat/long</p> <p>Verified completed intervals and squeeze (1516894)</p>	01/23/2019
Well File Verification	Pass	01/23/2019

Total: 3 comment(s)