

FORM
6Rev
05/18State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401927754

Date Received:

02/04/2019

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 10110

Contact Name: Michael Andrews

Name of Operator: GREAT WESTERN OPERATING COMPANY LLC

Phone: (970) 364-2811

Address: 1001 17TH STREET #2000

Fax:

City: DENVER State: CO Zip: 80202

Email: mandrews@gwogco.com

For "Intent" 24 hour notice required,

Name: Carlile, Craig

Tel: (970) 629-8279

COGCC contact:

Email: craig.carlile@state.co.us

API Number 05-123-21599-00

Well Name: HICKS

Well Number: 3-7

Location: QtrQtr: NENW Section: 7 Township: 3N Range: 67W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.246217

Longitude: -104.935025

GPS Data:

Date of Measurement: 11/06/2008

PDOP Reading: 2.7

GPS Instrument Operator's Name: Cody Mattson

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 2500

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7219	7234			
NIOBRARA	6962	7042			

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	762	550	762	0	CALC
1ST	7+7/8	4+1/2	11.6	7,372	490	7,382	3,450	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6900 with 25 sacks cmt on top. CIPB #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIPB #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 75 sks cmt from 2550 ft. to 2200 ft. Plug Type: STUB PLUG Plug Tagged: ☐
Set 46 sks cmt from 150 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☒
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 150 sacks half in. half out surface casing from 1000 ft. to 500 ft. Plug Tagged: ☒

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Plugging Date: _____
of _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Proposed Operation:
MIRU, Pull tbg
Set CIBP at 6900' pump 25sx on plug
Cut and pull 4-1/2" casing from 2500'
Pump 75sx from 2550' to 2200'
Pump 150sx from 1000' to 500'
Pump 25sx from 80' to surface
RDMO
Cut and cap casing 4-6' below GL

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Renee Kendrick
Title: Senior Regulatory Analyst Date: 2/4/2019 Email: rkendrick@gwogco.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Jacobson, Eric Date: 2/11/2019

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: 8/10/2019

COA Type	Description
	<p>CHANGE TO PROCEDURE</p> <p>Balanced casing plug at 1000' must be tagged.</p> <p>Moved plug at 80' down to 150' to be 50' deeper than water well within 1 mile. Added 21 sacks for a total of 46 sacks.</p>
	<p>If there has not been a reported Bradenhead test within 60 days of plugging this well, prior to starting plugging operations, a Bradenhead test shall be performed.</p> <p>1) If, before opening the Bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>3) If sampling is required contact COGCC engineering for an confirmation of plugging requirements prior to placing any plugs.</p> <p>Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions.</p> <p>The Form 17 shall be submitted within 10 days of the test.</p>
	<p>1) Provide 48 hour notice of plugging MIRU via electronic Form 42.</p> <p>2) Prior to placing the 1,000' plug: verify that all fluid migration (liquid or gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>3) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 712' or shallower and provide 10 sack plug at surface.</p> <p>4) Leave at least 100' of cement in the wellbore for each plug.</p> <p>5) Properly abandon on-location flowlines as per Rule 1105. File electronic Form 42 once abandonment is complete. Within 30 days of an operator completing abandonment requirements for an off-location flowline or crude oil transfer line, the operator must submit a Flowline Report, Form 44.</p>
	<p>Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.</p>

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
401927754	FORM 6 INTENT SUBMITTED
401927773	WELLBORE DIAGRAM
401927775	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Engineer	Deepest Water Well within 1 Mile – 101' SB5 Base of Fox Hills - N/A	02/11/2019
Well File Verification	Pass	02/08/2019
Permit	Pass	02/04/2019

Total: 3 comment(s)