

FORM
6

Rev
05/18

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
Document Number: 401947137			
Date Received:			

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: <u>69175</u>	Contact Name: <u>Valerie Danson</u>
Name of Operator: <u>PDC ENERGY INC</u>	Phone: <u>(970) 506-9272</u>
Address: <u>1775 SHERMAN STREET - STE 3000</u>	Fax: _____
City: <u>DENVER</u> State: <u>CO</u> Zip: <u>80203</u>	Email: <u>valerie.danson@pdce.com</u>

For "Intent" 24 hour notice required, Name: _____ Tel: _____
 COGCC contact: Email: _____

API Number: <u>05-123-25913-00</u>	Well Number: <u>23-10</u>
Well Name: <u>WELLS RANCH</u>	
Location: QtrQtr: <u>NESW</u> Section: <u>10</u> Township: <u>5N</u> Range: <u>63W</u> Meridian: <u>6</u>	
County: <u>WELD</u>	Federal, Indian or State Lease Number: _____
Field Name: <u>WATTENBERG</u>	Field Number: <u>90750</u>

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.411640 Longitude: -104.425610

GPS Data:
 Date of Measurement: 09/02/2008 PDOP Reading: 1.3 GPS Instrument Operator's Name: HOLLY L. TRACY

Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____

Casing to be pulled: Yes No Estimated Depth: _____

Fish in Hole: Yes No If yes, explain details below

Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below

Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6654	6660			
NIOBRARA	6484	6492			
Total: 2 zone(s)					

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	457	350	457	0	VISU
1ST	7+7/8	4+1/2	11.6	6,777	630	6,777	0	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6334 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 40 sks cmt from 1822 ft. to 1212 ft. Plug Type: CASING Plug Tagged:
Set 50 sks cmt from 682 ft. to 0 ft. Plug Type: CASING Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)
Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged:
Set _____ sacks at surface
Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Plugging Date: 01/25/2019
of _____
*Wireline Contractor: C&J Energy Services *Cementing Contractor: C&J Energy Services
Type of Cement and Additives Used: Type III 14.8 PPG Portland Cement
Flowline/Pipeline has been abandoned per Rule 1105 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Wells Ranch 23-10 (05-123-25913)/Plugging Procedure
Producing Formation: Codell: 6654'-6660' Niobrara: 6484'-6492'
Upper Pierre Aquifer: 460'-1520'
TD: 6790' PBTD: 6754'
Surface Casing: 8 5/8" 24# @ 457' w/ 350 sxs
Production Casing: 4 1/2" 11.6# @ 6777.1' w/ 630 sxs cmt (TOC @ Surface' - CBL).

Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6334'. Top with 2 sxs 15.8#/gal CI G cement.
4. TIH with tubing to 1822'. RU cementing company. Mix and pump 40 sxs 14.8#/gal Type III cement down tubing (Pierre coverage from 1800'-1300'). TOC at 1212'.
5. Pickup tubing to 682'. Mix and pump 50 sxs 14.8#/gal Type III cement down tubing. Cement circulate to surface.
6. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Valerie Danson
Title: Reg Tech Date: _____ Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY:

<u>COA Type</u>	<u>Description</u>

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
401947173	CEMENT JOB SUMMARY
401947176	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)