

**FORM  
INSP**Rev  
X/15**State of Colorado  
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

02/26/2019

Submitted Date:

02/26/2019

Document Number:

688401404**FIELD INSPECTION FORM**
 Loc ID 322864 Inspector Name: Silver, Randy On-Site Inspection ☐ 2A Doc Num:                     
**Operator Information:**OGCC Operator Number: 46290Name of Operator: KP KAUFFMAN COMPANY INCAddress: 1675 BROADWAY, STE 2800City: DENVER State: CO Zip: 80202**Status Summary:**

- ☒ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

**Findings:**13 Number of Comments4 Number of Corrective Actions☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM  
PREVIOUS INSPECTIONS THAT HAVE NOT  
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Lara-Mesa, Susana	303-825-4822	cogcc@kpk.com	<a href="#">All inspections</a>

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
244389	WELL	PR	02/25/1985	OW	123-12183	LOEHR, LARRY R 1	SI

**General Comment:**

**Location**Overall Good: ☒

<b>Signs/Marker:</b>			
Type	BATTERY		
Comment:	Adequate		
Corrective Action:		Date:	
Type	WELLHEAD		
Comment:	Adequate		
Corrective Action:		Date:	
Type	TANK LABELS/PLACARDS		
Comment:	NDPA placard on 300 BBL crude oil tank faded needs to be replaced (see photo)		
Corrective Action:	Install sign to comply with Rule 210.d.	Date:	04/26/2019

Emergency Contact Number:

Comment:

Corrective Action:

Date: \_\_\_\_\_

**Good Housekeeping:**

Type	OTHER		
Comment:	WH leaking what appears to be gas on top of WH around tubing. ECD pilot not lit and appears to be venting gas.		
Corrective Action:	Securely fasten all valves, pipes, and fittings to ensure good mechanical condition, inspect at regular intervals and maintain in good mechanical condition per Rule 605.d.	Date:	02/27/2019
Type	OTHER		
Comment:	Bull plugs on load lines of crude oil tanks and on drain lines of Separators.		
Corrective Action:	Location is within a designated setback location, bullplug or cap all loadlines per Rule 604.c.(2)O.	Date:	03/05/2019
Type	OTHER		
Comment:	Stained soil around recirc pump, load lines for crude oil tanks, inside separator house and on ground outside of crude oil tank containment appears to be from trucks off loading.		
Corrective Action:	Properly treat or dispose of oily waste in accordance with 907.e.	Date:	03/26/2019

Overall Good: ☐

<b>Spills:</b>			
Type	Area	Volume	

In Containment: No

Comment:

☐ Multiple Spills and Releases?

<b>Fencing/:</b>			
Type	PUMP JACK		
Comment:	barb wire		
Corrective Action:		Date:	

<b>Equipment:</b>			corrective date
Type: Emission Control Device	# 2		
Comment:			
Corrective Action:			Date:
Type: Pump Jack	# 1		
Comment:			
Corrective Action:			Date:
Type: Prime Mover	# 1		
Comment:	electric motor		
Corrective Action:			Date:
Type: Horizontal Heated Separator	# 2		
Comment:			
Corrective Action:			Date:
Type: Ancillary equipment	# 1		
Comment:	Electric panel		
Corrective Action:			Date:
Type: Gas Meter Run	# 2		
Comment:			
Corrective Action:			Date:
Type: Bird Protectors	# 5		
Comment:			
Corrective Action:			Date:

**Tanks and Berms:**

Contents	#	Capacity	Type	Tank ID	SE GPS
PRODUCED WATER	1	OTHER	CONCRETE SUMP/VAULT		,
Comment:					
Corrective Action:					Date:

**Paint**

Condition	Adequate	
Other (Content)		
Other (Capacity)	50BBL	
Other (Type)		

**Berms**

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance	
Comment:	Shares containment with crude oil tanks				
Corrective Action:				Date:	
Contents	#	Capacity	Type	Tank ID	SE GPS
CRUDE OIL	4	300 BBLs	STEEL AST		40.095129,104.781950
Comment:					

Corrective Action:		Date:		
<b>Paint</b>				
Condition	Adequate			
Other (Content)				
Other (Capacity)				
Other (Type)				
<b>Berms</b>				
Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Earth	Adequate	Walls Sufficient	Base Sufficient	Adequate
Comment:				
Corrective Action:		Date:		
<b>Venting:</b>				
Yes/No	NO			
Comment:				
Corrective Action:			Date:	
<b>Flaring:</b>				
Type				
Comment:				
Corrective Action:			Date:	

**Inspected Facilities**Facility ID: 244389 Type: WELL API Number: 123-12183 Status: PR Insp. Status: SI**Idle Well**Purpose: ☒ Shut In ☐ Temporarily Abandoned

Reminder: \_\_\_\_\_

Comment: SI

Corrective Action: \_\_\_\_\_

Date: \_\_\_\_\_

**COGCC Comments**

Comment	User	Date
This is a follow up inspection per Doc#691400327. All corrective actions have been addressed at time of inspection. Tank has been removed from location. At time of inspection observed what appeared to be gas leaking from well head and ECD pilot was not lit at battery site. Called emergency contact number was told by operator they would send pumper. While on site performing inspection pumper showed up on location and repaired well head and relit pilot.	silverr	02/26/2019

**Attached Documents**You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
688401405	loc pic	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4745982">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4745982</a>
688401406	WH vidieo	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4745983">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4745983</a>