

FORM
6Rev
05/18

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

402005427

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required,

Name: Santistevan, Brittani

Tel: (720) 471-1110

COGCC contact:

Email: brittani.santistevan@state.co.us

API Number 05-123-12048-00

Well Name: TRACY

Well Number: 1

Location: QtrQtr: NWSW Section: 22 Township: 5N Range: 65W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 63179

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.382778

Longitude: -104.656389

GPS Data:

Date of Measurement: 05/04/2010

PDOP Reading: 2.1

GPS Instrument Operator's Name: Chuck Kraft

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 1500

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA-CODELL	6698	7022	08/10/2017	B PLUG CEMENT TOP	6640

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	348	300	348	0	VISU
1ST	7+7/8	4+1/2	11.6	7,134	250	7,134	5,980	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth _____ with _____ sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 255 sks cmt from 1615 ft. to 1200 ft. Plug Type: STUB PLUG Plug Tagged: ☐
Set 345 sks cmt from 548 ft. to 0 ft. Plug Type: OPEN HOLE Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 4500 ft. with 190 sacks. Leave at least 100 ft. in casing 4165 CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Plugging Date: _____
of _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Tracy 1 (05-123-12048)/Plugging Procedure (Intent)

Producing Formation: Niobrara/Codell: 6698'-7022'

Upper Pierre Aquifer: 390'-1310'

TD: 7134' PBTD: 7107'

Surface Casing: 8 5/8" 24# @348' w/ 300 sxs cmt

Production Casing: 4 1/2" 11.6# @ 7134' w/ 250 sxs cmt (TOC @ 5980' - CBL).

CIBP @ 6640' with 2 sxs cmt (8/10/2017).

Sliding Sleeve @ 3882'.

Tubing: 2 3/8" tubing set @ 6459.4' (8/10/2017).

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with perf gun. Shoot lower squeeze holes at 4500'. Shoot upper squeeze holes at 4150' for Sussex coverage.
4. Set CICR at 4165'. RU cementing company. Sting in and pump 190 sxs 15.8#/gal CI G cement. Sting out and pump 45 sxs on top of CICR (Includes Sliding Sleeve coverage from 4132'-3632'). TOOH with tubing.
5. TIH with casing cutter. Cut 4 1/2" casing at 1500'. Pull cut casing.
6. TIH with tubing to 1615'. Mix and pump 255 sxs 15.8#/gal CI G cement w/ 2% CaCl down tubing (Pierre aquifer coverage from 1615'-1200').
7. Pickup tubing to 548'. Mix and pump 345 sxs 15.8#/gal CL G cement down tubing. Cement should circulate to surface.
8. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: Valerie Danson

Title: Reg Tech

Date: _____

Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

COA Type

Description

--	--

Attachment Check List

Att Doc Num

Name

402005505	WELLBORE DIAGRAM
402005506	WELLBORE DIAGRAM
402005507	GYRO SURVEY

Total Attach: 3 Files

General Comments

User Group

Comment

Comment Date

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)