

FORM
6Rev
05/18

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

402002141

Date Received:

04/09/2019

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: Sonu Choudhary

Name of Operator: NOBLE ENERGY INC

Phone: (303) 228-4302

Address: 1001 NOBLE ENERGY WAY

Fax:

City: HOUSTON State: TX Zip: 77070

Email: narayan.choudhary@nblenergy.com

For "Intent" 24 hour notice required,

Name: Medina, Justin

Tel: (720) 471-0006

COGCC contact:

Email: justin.medina@state.co.us

API Number 05-123-21605-00

Well Name: LDS

Well Number: 20-8

Location: QtrQtr: SESE Section: 8 Township: 3N Range: 64W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.236190

Longitude: -104.570250

GPS Data:

Date of Measurement: 11/10/2006

PDOP Reading: 3.4

GPS Instrument Operator's Name: Chris Fisher

Reason for Abandonment: ☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 2500

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6962	6976			
NIOBRARA	6694	6850			

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	797	560	797	12	CALC
1ST	7+7/8	4+1/2	11.60	7,110	175	7,110	6,250	CBL
S.C. 1.1				4,700	210	4,700	4,000	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6644 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set <u>40</u> sks cmt from <u>4500</u> ft. to <u>4000</u> ft.	Plug Type: <u>CASING</u>	Plug Tagged: <input type="checkbox"/>
Set <u>195</u> sks cmt from <u>2500</u> ft. to <u>2000</u> ft.	Plug Type: <u>STUB PLUG</u>	Plug Tagged: <input type="checkbox"/>
Set <u>80</u> sks cmt from <u>997</u> ft. to <u>797</u> ft.	Plug Type: <u>CASING</u>	Plug Tagged: <input type="checkbox"/>
Set <u>250</u> sks cmt from <u>797</u> ft. to <u>12</u> ft.	Plug Type: <u>CASING</u>	Plug Tagged: <input checked="" type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>

Perforate and squeeze at 3950 ft. with 120 sacks. Leave at least 100 ft. in casing 3850 CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Plugging Date: _____
of _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Diane Blair

Title: Operations Technician Date: 4/9/2019 Email: diane.blair@nblenergy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Jacobson, Eric Date: 4/15/2019

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: 10/14/2019

COA Type	Description
	<p>WITH KNOWN BRADENHEAD PRESSURE</p> <p>The plug at 2500' needs to be placed and have an 8 hour WOC to assure that all fluid migration has been stopped. If that doesn't isolate the flow, additional attempts in front of the surface shoe plug will need to be attempted. Other downhole potential squeeze opportunities may need to be looked at before the 997' plug.</p>
	<p>If there has not been a reported Bradenhead test within 60 days of plugging this well, prior to starting plugging operations, a Bradenhead test shall be performed.</p> <p>1) If, before opening the Bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>3) If sampling is required contact COGCC engineering for a confirmation of plugging requirements prior to placing any plugs.</p> <p>Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions.</p> <p>The Form 17 shall be submitted within 10 days of the test.</p>
	<p>1) Provide 48 hour notice of plugging MIRU via electronic Form 42.</p> <p>2) Prior to placing the 997' plug: verify that all fluid migration (liquid or gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>3) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 747' or shallower and provide 10 sack plug at surface.</p> <p>4) Leave at least 100' of cement in the wellbore for each plug.</p> <p>5) Properly abandon on-location flowlines as per Rule 1105. File electronic Form 42 once abandonment is complete. Within 30 days of an operator completing abandonment requirements for an off-location flowline or crude oil transfer line, the operator must submit a Flowline Report, Form 44.</p>
	Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.
	Reported "as drilled" GPS data is inaccurate. Submit accurate "as drilled" GPS data on Subsequent Report of Abandonment. GPS data must meet the requirements of Rule 215.

Attachment Check List

Att Doc Num	Name
2137760	WELLBORE DIAGRAM
402002141	FORM 6 INTENT SUBMITTED
402002146	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

User Group	Comment	Comment Date
Engineer	<p>Deepest Water Well within 1 Mile – 420'</p> <p>SB5 Base of Fox Hills - 463'</p> <p>Added casing cut at 2500' and updated WBD after confering with operator. Operator in agreement.</p>	04/11/2019
Well File Verification	Pass	04/11/2019
Permit	<ul style="list-style-type: none"> •Verified perped intervals via Doc. 1707839 •Verified production reporting 	04/10/2019

Total: 3 comment(s)