

FORM
6Rev
05/18

State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

402017662

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required.

Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 8960

Contact Name: Kate Miller

Name of Operator: BONANZA CREEK ENERGY OPERATING COMPANY

Phone: (720) 440-6116

Address: 410 17TH STREET SUITE #1400

Fax:

City: DENVER

State: CO

Zip: 80202

Email: regulatory@bonanzacrk.com

For "Intent" 24 hour notice required,

Name: Peterson, Tom

Tel: (970) 370-1281

COGCC contact:

Email: tom.peterson@state.co.us

API Number 05-123-32980-00

Well Name: Park

Well Number: S-4

Location: QtrQtr: SESE

Section: 4

Township: 4N

Range: 63W

Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.337050

Longitude: -104.437693

GPS Data:

Date of Measurement: 03/13/2012

PDOP Reading: 1.3

GPS Instrument Operator's Name: Adam Kelly

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ Other

Casing to be pulled:

☒ Yes☐ No

Estimated Depth: 850

Fish in Hole:

☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6556	6568			
NIOBRARA	6304	6446			

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	750	307	750	0	CALC
1ST	7+7/8	4+1/2	11.6	6,703	580	6,703	2,500	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6250 with 25 sacks cmt on top. CIPB #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIPB #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 550 sks cmt from 950 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

- 1) MIRU ON LOCATION. ND WH, NU BOP, RU WORK FLOOR, CONTROL WELL, TOO H WITH 2 3/8TH" TBG
- 2) MIRU WIRELINE AND SET CIBP @ 6250'
- 3) PLACE 25 SX CEMENT ON THE CIBP @ 6250'
- 4) MIRU WIRELINE. CUT AND PULL CASING @850'
- 5) TIH WITH TBG TO 950'.
- 6) PUMP 550 SX CEMENT TO SURFACE
- 7) ND BOP. CUT OFF BELL NIPPLE & CASING TO 4' BELOW GROUND LEVEL. FILL TOP OF CASING WITH READY MIX
- 8) WELD ON PLATE. OPERATOR NAME, API NO., LOCATION
- 9) FILL SURFACE HOLE, MAKING SURE TO REPLACE TOP SOIL LAST
- 10) RIG DOWN AND MOVE OUT ALL EQUIPMENT

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Aubrey Noonan
Title: Regulatory Analyst Date: _____ Email: regulatory@bonanzacrk.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: _____

COA Type

Description

--	--

Attachment Check List

Att Doc Num

Name

402018565	WELLBORE DIAGRAM
-----------	------------------

402018570	WELLBORE DIAGRAM
-----------	------------------

Total Attach: 2 Files

General Comments

User Group

Comment

Comment Date

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)