

Engineer: David McDaniel
Cell Phone Number: 970-515-1532

PLUG and ABANDONMENT PROCEDURE

HSR-MCHALE 7-5A

Description

1. Provide 48 hour notice to COGCC prior to rig up per request on approved Form 6 (e.g. call field coordinator, submit Form 42, etc.). Notify Automation Removal Group at least 24 hours prior to rig move. Request they catch and remove plunger, isolate production equipment, and remove any automation prior to rig MIRU.
2. MIRU Slickline. Pull production equipment and tag bottom. Record tag depth in Open Wells. Gyro was run on 01/07/14. RDMO Slickline.
3. Prepare location for base beam equipped rig. Install perimeter fence as needed.
4. Verify COAs before RU.
5. Upon RU, check and record bradenhead pressure. If bradenhead valve is not accessible, re-plumb so that valve is above GL. Blow down bradenhead and re-check pressure the next day. Repeat until pressure stays at 0 psi.
6. MIRU WO rig. Kill well as necessary using biocide treated fresh water. Verify BOP and wellhead rating, inspect for appropriate API standards, pressure test BOP according to VWP BOP testing guidelines. ND WH. NU BOP. Unland tbg using unlanding joint and LD.
7. TOOH and SB 7270' 2-3/8" tbg. LD any remainder.
8. MIRU WL. PU and RIH with (4-1/2", 11.6#) gauge ring to 7700'. POOH.
9. PU and RIH with (4-1/2", 11.6#) CIBP and set at +/- 7690' (collars at 7673' & 7715'). POOH. RIH and dump 2 sx cement on CIBP. POOH.
10. PU and RIH with (4-1/2", 11.6#) CIBP and set at +/- 7270' (collars at 7249' & 7292'). POOH. RDMO WL.
11. TIH with 2-3/8" tbg to 7270'
12. Load hole with biocide treated fresh water and circulate all gas out of well. PT CIBP to 1000 psi for 15 minutes.
13. MIRU cementers. Pump Niobrara Balance Plug: Pump 35 sx (9.6 bbl or 54 cf), assuming 15.8 ppg & 1.53 cf/sk. Volume based on 575' inside 4-1/2", 11.6# production casing with no excess. Cement will be from 7270'-6695'.
14. Pull out of cement at a rate of 1 jt/min. TOOH to 5230', LD 2-3/8" tubing.
15. Pump Balance Plug: Pump 10 sx (2.8 bbl or 16 cf), assuming 15.8 ppg & 1.53 cf/sk. Volume based on 175' inside 4-1/2", 11.6# production casing with no excess. Cement will be from 5230'-5055'. Collect wet and dry samples of cement to be left on rig. RDMO Cementers.
16. Pull out of cement at a rate of 1 jt/min. TOOH, SB 4000' 2-3/8" tbg. LD remaining tbg.
17. MIRU WL. RIH and jet cut 4-1/2", 11.6# casing at 2000'. RDMO WL.
18. Attempt to establish circulation and circulate (58 bbl) with fresh water containing biocide to remove any gas.
19. ND BOP. ND TH. Un-land casing using a casing spear, not a lifting sub. Rig max pull shall be 100,000#. Max pull over string weight shall be 50,000#. If unable to unland, contact Engineering.
20. Install BOP on casing head with 4-1/2", 11.6# pipe rams.
21. TOOH and LD all 4-1/2", 11.6# casing. Remove 4-1/2", 11.6# pipe rams and install 2-3/8" pipe rams.

22. TIH with mule shoe and 2-3/8" tubing to 4000'.
23. Establish circulation to surface with biocide treated fresh water and pump at least three hole-volumes (174 bbl) to circulate all gas out of the well. Contact engineering if evidence of gas migration persists.
24. MIRU Cementers. Pump Sussex Plug: Pump 10 sx (2.8 bbl or 16 cf), assuming 14 ppg & 1.55 cf/sk. Volume based on 178' inside 4-1/2", 11.6# production casing with no excess. Cement will be from 4000'-3822'.
25. Pull out of cement at a rate of 1 jt/min. TOOH to 2100', LD 2-3/8" tubing.
26. Pump Lower Stub Plug: 180 sx (49.7 bbl or 279 cf), assuming 14 ppg & 1.55 cf/sk. Volume is based on 100' in 4-1/2", 11.6# production casing with no excess. The plug is designed to cover 2100'-1600'. Collect wet and dry samples of cement to be left on rig. RDMO Cementers. Notify engineering if circulation is ever lost during job.
27. Pull out of cement at a rate of 1 jt/min. TOOH to 1100'. Reverse circulate using biocide treated fresh water to ensure the tubing is clean. TOOH, SB 1700' 2-3/8" tbg. LD remaining tbg. WOC.
28. TIH with mule shoe on 2-3/8" tubing and tag cement. TOOH to 800'. Establish circulation and pump at least three hole-volumes (174 bbl) to circulate all gas out of the well. Contact engineering if evidence of gas migration persists.
29. MIRU cementers. Pump Stub Plug: Pump 110 sx (30.4 bbl or 171 cf), assuming 14 ppg & 1.55 cf/sk. Volume is based on 123' in 7.875" bit size open hole with 100% excess factor. 202' in the 8-5/8", 24# surface casing with no excess. The plug is designed to cover 800'-475'. Collect wet and dry samples of cement to be left on rig. RDMO Cementers. Notify engineering if circulation is ever lost during job.
30. Pull out of cement at a rate of 1 jt/min. TOOH to 150'. Reverse circulate using biocide treated fresh water to ensure the tubing is clean. TOOH, SB 580' 2-3/8" tbg. WOC.
31. TIH with mule shoe on 2-3/8" tbg and tag cement to verify appropriate coverage above the surface casing shoe. Pressure test casing to 500 psi and hold for 15 minutes. TOOH to 150', LD 2-3/8" tbg.
32. MIRU Cementers. Pump Surface Plug: Pump 50 sx (10.5 bbl or 58 cf) Class G cement, assuming 15.8 ppg & 1.15 cf/sk. Volume based on 150' inside 8-5/8", 24# surface casing with no excess. Cement will be from 150' to surface. Verify and document cement to surface. Collect wet and dry samples of cement to be left on rig. RDMO Cementers.
33. Pull out of cement at a rate of 1 jt/min. TOOH, LD all 2-3/8" tbg. Tag cement as needed to verify cement to surface. RDMO WO rig.
34. Instruct cementing and wireline contractors to e-mail copies of all job logs/job summaries to rscDJVendors@anadarko.com within 24 hours of completion of the job.
35. Supervisor submit paper copies of all invoices, logs, and reports to VWP Engineering Specialist.
36. Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.
37. Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
38. Welder cut casing minimum 5' below ground level.
39. Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
40. Obtain GPS location data as per COGCC Rule 215 and send to rscDJVendors@anadarko.com.
41. Properly abandon flow lines per Rule 1103. File electronic Form 42 once abandonment is complete.
42. Back fill hole with fill. Clean location, and level.
43. Submit Form 6 to COGCC ensuring to provide 'As performed' WBD identifying operations completed.