

FORM
6Rev
05/18

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

402009016

Date Received:

04/15/2019

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 24500

Contact Name: Dan Richmond

Name of Operator: PADCO LLC

Phone: (918) 630-+-9912

Address: P O BOX 5275

Fax:

City: BEVERLY HILLS State: CA Zip: 90209-

Email: dan@dsrinc.net

For "Intent" 24 hour notice required,

Name: Sherman, Susan

Tel: (719) 775-1111

COGCC contact:

Email: susan.sherman@state.co.us

API Number 05-121-10573-00

Well Name: SHARP-BLAKE

Well Number: 2-A

Location: QtrQtr: SWSW Section: 27 Township: 1S Range: 55W Meridian: 6

County: WASHINGTON

Federal, Indian or State Lease Number:

Field Name: KENO

Field Number: 43900

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 39.931890

Longitude: -103.533360

GPS Data:

Date of Measurement: 12/27/2007

PDOP Reading: 2.0

GPS Instrument Operator's Name: Darren Veal

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ Other

Casing to be pulled:

☒ Yes☐ No

Estimated Depth: 3850

Fish in Hole:

☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
D SAND	4900	4929			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	25	131	117	131	0	VISU
1ST	7+7/8	5+1/2	14 & 15.5	5,028	150	5,028	3,966	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 4870 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 40 sks cmt from 3900 ft. to 3750 ft. Plug Type: STUB PLUG Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 50 sacks half in. half out surface casing from 180 ft. to 80 ft. Plug Tagged: ☐

Set 10 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Plugging Date: _____
of _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Dan Richmond

Title: Field Operations Super. Date: 4/15/2019 Email: dan@dsrinc.net

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: SUTPHIN, DIRK Date: 5/21/2019

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: 11/20/2019

COA Type **Description**

COA Type	Description

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
402009016	FORM 6 INTENT SUBMITTED
402009060	WELLBORE DIAGRAM
402009064	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Engineer	<p>Plugging:</p> <ol style="list-style-type: none">1) Provide 48 hour notice of MIRU via electronic Form 42.2) Shoe plug: Tag plug 50' above surface casing shoe.3) Surface plug: Cement from 50' to surface. <p>Bradenhead:</p> <p>Prior to starting plugging operations a bradenhead test shall be performed if there has not been a reported bradenhead test within the 60 days immediately preceding the start of plugging operations. The Form 17 shall be submitted within 10 days of the test.</p> <ol style="list-style-type: none">1) If before opening the Bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required. <p>Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions, Appendix A: Liquid and Gas Sampling.</p> <p>If there is a need for sampling, contact COGCC engineering for verification of plugging procedure.</p> <p>Venting during plugging:</p> <p>Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.</p> <p>Flowlines:</p> <p>Properly abandon flowlines per Rule 1105. File electronic Form 42 once abandonment is complete. Within 30 days of an operator completing abandonment requirements for an off-location flowline or crude oil transfer line, the operator must submit a Flowline Report, Form 44.</p>	05/21/2019
Engineer	Plugging: Changed the depth o cement at stub plug: Cement is from 50' below casing cut to 100' above casing cut.	05/21/2019
Well File Verification	Pass	04/17/2019

Total: 3 comment(s)