

FORM  
6Rev  
05/18State of Colorado  
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
Document Number: 402047594			
Date Received: 05/17/2019			

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322	Contact Name: Heather Burt
Name of Operator: NOBLE ENERGY INC	Phone: (303) 898-3918
Address: 1001 NOBLE ENERGY WAY	Fax:
City: HOUSTON State: TX Zip: 77070	Email: heather.burt@nblenergy.com
For "Intent" 24 hour notice required, Name: Santistevan, Brittani Tel: (720) 471-1110	
COGCC contact: Email: brittani.santistevan@state.co.us	

API Number 05-123-22797-00	Well Number: 6-13
Well Name: WEBER	
Location: QtrQtr: SWNE Section: 6 Township: 6N Range: 66W Meridian: 6	
County: WELD	Federal, Indian or State Lease Number:
Field Name: EATON	Field Number: 19350

☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.518180	Longitude: -104.820050
GPS Data:	
Date of Measurement: 12/15/2006	PDOP Reading: 2.5 GPS Instrument Operator's Name: WADE FIRESTIEN
Reason for Abandonment: <input type="checkbox"/> Dry <input checked="" type="checkbox"/> Production Sub-economic <input type="checkbox"/> Mechanical Problems	
<input type="checkbox"/> Other	
Casing to be pulled: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No	Estimated Depth: 2500
Fish in Hole: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If yes, explain details below
Wellbore has Uncemented Casing leaks: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If yes, explain details below
Details:	

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7338	7354			

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	884	380	884	0	VISU
1ST	7+7/8	4+1/2	11.6	7,497	815	7,497	3,358	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7286 with 2 sacks cmt on top. CIPB #2: Depth 6974 with 2 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIPB #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 185 sks cmt from 2500 ft. to 2000 ft. Plug Type: STUB PLUG Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 355 sacks half in. half out surface casing from 1084 ft. to 0 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
of \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Stephanie Dionne

Title: Operations Tech Date: 5/17/2019 Email: stephanie.dionne@nblenergy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: JENKINS, STEVE Date: 5/23/2019

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: 11/22/2019

<b>COA Type</b>	<b>Description</b>
	<p>1) Provide 48 hour notice of plugging MIRU via electronic Form 42.</p> <p>2) Prior to placing the 1084' plug: verify that all fluid migration (liquid or gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>3) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 834' or shallower and provide 10 sx plug at the surface.</p> <p>4) Leave at least 100' of cement in the wellbore for each plug.</p> <p>5) Properly abandon flowlines per Rule 1105. File electronic Form 42 once abandonment is complete. Within 30 days of an operator completing abandonment requirements for an off-location flowline or crude oil transfer line, the operator must submit a Flowline Report, Form 44.</p>
	Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.
	<p>If there has not been a reported Bradenhead test within 60 days of plugging this well, prior to starting plugging operations, a Bradenhead test shall be performed.</p> <p>1) If, before opening the Bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>3) If sampling is required contact COGCC engineering for a confirmation of plugging requirements prior to placing any plugs.</p> <p>Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. The Form 17 shall be submitted within 10 days of the test.</p>
	<p>Submit Operator's Monthly Production Reports (Form 7) required for compliance with Rule 309 within 30 days.</p> <p>•Missing July 2010, January 2012, February 2019, March 2019</p>

### **Attachment Check List**

<b><u>Att Doc Num</u></b>	<b><u>Name</u></b>
402047594	FORM 6 INTENT SUBMITTED
402047607	WELLBORE DIAGRAM
402047608	WELLBORE DIAGRAM

Total Attach: 3 Files

### **General Comments**

<b><u>User Group</u></b>	<b><u>Comment</u></b>	<b><u>Comment Date</u></b>
Well File Verification	Pass	05/23/2019
Engineer	<p>1) Deepest Water Well within 1 mile = 740'.</p> <p>2) Fox Hills Bottom- N/A, per SB5.</p>	05/23/2019
Permit	<p>•Verified SHL lat./long</p> <p>•Verified CODL perfed interval via Doc. 1865221</p>	05/17/2019

Total: 3 comment(s)