

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Valerie Danson
 Name of Operator: PDC ENERGY INC Phone: (970) 506-9272
 Address: 1775 SHERMAN STREET - STE 3000 Fax: _____
 City: DENVER State: CO Zip: 80203 Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required, Name: Medina, Justin Tel: (720) 471-0006
 COGCC contact: Email: justin.medina@state.co.us

API Number 05-123-28019-00 Well Number: 13N
 Well Name: GUTTERSEN
 Location: QtrQtr: SENW Section: 13 Township: 3N Range: 64W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.228830 Longitude: -104.500110
 GPS Data:
 Date of Measurement: 09/26/2008 PDOP Reading: 1.6 GPS Instrument Operator's Name: HOLLY L. TRACY
 Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: _____
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA-CODELL	6584	6803			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	678	520	678	0	VISU
1ST	7+7/8	4+1/2	10.5	6,961	810	6,961	0	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6534 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 40 sks cmt from 1800 ft. to 1300 ft. Plug Type: CASING Plug Tagged:
Set 70 sks cmt from 878 ft. to 0 ft. Plug Type: CASING Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)
Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged:
Set _____ sacks at surface
Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Plugging Date: _____
of _____
*Wireline Contractor: _____ *Cementing Contractor: _____
Type of Cement and Additives Used: _____
Flowline/Pipeline has been abandoned per Rule 1105 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Guttersen 13N (05-123-28019) Plugging Procedure (Intent)
Producing Formation: Niobrara/Codell: 6584'-6803'
Upper Pierre Aquifer: 660'-1540'
TD: 6969' PBTD: 6942'
Surface Casing: 8 5/8" 24# @ 678' w/ 520 sxs
Production Casing: 4 1/2" 10.5# @ 6961' w/ 810 sxs cmt (TOC @ surface' - CBL).
Tubing: 2 3/8" tubing set @ 6784' (11/14/2008).
Proposed Procedure:
1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6534'. Top with 2 sxs 15.8#/gal CI G cement.
4. TIH in tubing to 1800'. RU cementing company. Mix and pump 40 sxs 15.8#/gal CI G cement down tubing (Pierre coverage from 1800'-1300').
5. Pick up tubing to 878'. Mix and pump 70 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface. TOO H with tubing.
6. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Valerie Danson
Title: Reg Tech Date: _____ Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

COA Type

Description

COA Type	Description

Attachment Check List

Att Doc Num

Name

402065597	WELLBORE DIAGRAM
402065598	WELLBORE DIAGRAM
402065599	GYRO SURVEY

Total Attach: 3 Files

General Comments

User Group

Comment

Comment Date

User Group	Comment	Comment Date
		Stamp Upon Approval

Total: 0 comment(s)