

**FORM
INSP**Rev
X/15**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

06/04/2019

Submitted Date:

06/06/2019

Document Number:

689900801**FIELD INSPECTION FORM**Loc ID 324830 Inspector Name: COSTA, RYAN On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**OGCC Operator Number: 10085Name of Operator: ARMOR PETROLEUM INCAddress: P O BOX 4625City: WICHITA FALLS State: TX Zip: 76308**Status Summary:**☐ THIS IS A FOLLOW UP INSPECTION☒ FOLLOW UP INSPECTION REQUIRED☐ NO FOLLOW UP INSPECTION REQUIRED**Findings:**6 Number of Comments4 Number of Corrective Actions☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Kosola, Jason		jason.kosola@state.co.us	
Pesicka, Conor		conor.pesicka@state.co.us	
Fitts, Sherry	940-692-5001/100200	sherry@apiws.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
213002	WELL	PR	04/01/2004	OW	061-06363	DORSETT 1	RI

General Comment:

This is an interim reclamation and stormwater inspection performed at the Dorsett Tank Battery Site.

Location**Lease Road:**

Type			
comment:			
Corrective ActionL		Date:	

Overall Good: ☒**Signs/Marker:**

Type	CONTAINERS		
Comment:	There were two barrels with no labels on them at tank battery site. See Photos		
Corrective Action:	Install sign to comply with Rule 210.d.	Date:	08/05/2019
Type	BATTERY		
Comment:	Good		
Corrective Action:		Date:	

Emergency Contact Number:

Comment:		
Corrective Action:		Date: _____

Good Housekeeping:

Type	UNUSED EQUIPMENT		
Comment:	There is various unused equipment at the east side of the tank battery site.		
Corrective Action:	Remove all unused equipment including pump jack. Comply with Rule 603.f .	Date:	09/04/2019

Overall Good: ☐**Spills:**

Type	Area	Volume		
Crude Oil	Tank	<= 1 bbl		
Comment:	There is oil stained soil around the two barrels, between the tanks, at the pipe valve, and at the 300bbl tank. Possible leakage coming from barrels and tank. See Photos			
Corrective Action:	Properly treat or dispose of oily waste in accordance with 907.e			Date:

In Containment: No

Comment: ☐ Multiple Spills and Releases?**Tanks and Berms:**

Contents	#	Capacity	Type	Tank ID	SE GPS
CRUDE OIL	6				
Comment:					
Corrective Action:					Date:

Paint

Condition	Adequate	
Other (Content)		

Other (Capacity)	
Other (Type)	

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Earth	Inadequate	Walls Insufficient		Inadequate
Comment:	Inadequate berms around tanks. The berm along the north side of tank battery is insufficient and worn down.			
Corrective Action:	Repair or install berms or other secondary containment devices per Rule 605.a.(4).			Date: 07/06/2019

Venting:

Yes/No		
Comment:		
Corrective Action:		Date:

Flaring:

Type	
Comment:	
Corrective Action:	Date:

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
402067200	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4842676
689900802	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4842663