

**FORM**  
**6**  
Rev  
05/18

**State of Colorado**  
**Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
Document Number: 402083664			
Date Received:			

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: <u>69175</u>	Contact Name: <u>Valerie Danson</u>
Name of Operator: <u>PDC ENERGY INC</u>	Phone: <u>(970) 506-9272</u>
Address: <u>1775 SHERMAN STREET - STE 3000</u>	Fax: _____
City: <u>DENVER</u> State: <u>CO</u> Zip: <u>80203</u>	Email: <u>valerie.danson@pdce.com</u>

**For "Intent" 24 hour notice required,** Name: \_\_\_\_\_ Tel: \_\_\_\_\_  
 COGCC contact: Email: \_\_\_\_\_

API Number <u>05-123-26312-00</u>	Well Name: <u>GUTTERSEN</u>	Well Number: <u>12-13</u>
Location: QtrQtr: <u>SWNW</u> Section: <u>13</u> Township: <u>3N</u> Range: <u>64W</u> Meridian: <u>6</u>	County: <u>WELD</u> Federal, Indian or State Lease Number: _____	
Field Name: <u>WATTENBERG</u>	Field Number: <u>90750</u>	

Notice of Intent to Abandon       Subsequent Report of Abandonment

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.227060 Longitude: -104.506690

GPS Data:  
 Date of Measurement: 06/10/2008 PDOP Reading: 1.6 GPS Instrument Operator's Name: HOLLY TRACY

Reason for Abandonment:  Dry     Production Sub-economic     Mechanical Problems  
 Other \_\_\_\_\_

Casing to be pulled:  Yes     No    Estimated Depth: \_\_\_\_\_

Fish in Hole:  Yes     No    If yes, explain details below

Wellbore has Uncemented Casing leaks:  Yes     No    If yes, explain details below

Details: \_\_\_\_\_

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6831	6837	05/30/2019	B PLUG CEMENT TOP	6561
NIOBRARA	6611	6617	05/30/2019	B PLUG CEMENT TOP	6561
Total: 2 zone(s)					

**Casing History**

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	688	530	688	0	VISU
1ST	7+7/8	4+1/2	11.6	6,990	895	6,990	875	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6561 with 2 sacks cmt on top. CIBP #2: Depth 4000 with 2 sacks cmt on top.  
 CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 40 sks cmt from 1805 ft. to 1195 ft. Plug Type: CASING Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:

Perforate and squeeze at 865 ft. with 190 sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 (Cast Iron Cement Retainer Depth)

Set 60 sacks half in. half out surface casing from 904 ft. to 0 ft. Plug Tagged:   
 Set \_\_\_\_\_ sacks at surface  
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No  
 Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Plugging Date: 05/31/2019  
 of \_\_\_\_\_  
 \*Wireline Contractor: C&J Energy Services \*Cementing Contractor: C&J Energy Services  
 Type of Cement and Additives Used: Type III 14.8 PPG Portland Cement  
 Flowline/Pipeline has been abandoned per Rule 1105  Yes  No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

Guttersen 12-13 (05-123-26312)/Plugging Procedure  
 Producing Formation: Niobrara/Codell: 6611'-6837'  
 Upper Pierre Aquifer: 650'-1530'  
 TD: 7018' PBTD: 6960.7'  
 Surface Casing: 8 5/8" 24# @688' w/ 530 sxs  
 Production Casing: 4 1/2" 11.6# @ 6990.5' w/ 895 sxs cmt (TOC @ 875' - CBL).

Procedure:  
 1. MIRU pulling unit. Pull 2 3/8" tubing.  
 2. RU wireline company.  
 3. TIH with CIBP. Set BP at 6561'. Top with 2 sxs 15.8#/gal CI G cement.  
 4. TIH with CIBP. Set BP at 4000'. Top with 2 sxs 15.8#/gal CI G cement.  
 5. Run Strip Log 1100' to Surface.  
 6. TIH with perforation gun. Shoot holes for annular squeeze at 865'.  
 7. TIH with tubing to 1805'. RU cementing company. Mix and pump 40 sxs 14.8#/gal Type III cement down tubing. (Pierre coverage from 1800'-1300'). TOC at 1195'.  
 8. TIH with tubing to 904'. Mix and pump 60 sxs 14.8#/gal Type III cement down tubing. Cement circulate to surface.  
 9. Close off casing returns. Hook up cement line to cement flange and pump 190 sxs 14.8#/gal Type III cement downhole and squeeze through perforations at 865' into annular space. Cement circulate to surface.  
 10. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Valerie Danson  
 Title: Reg Tech Date: \_\_\_\_\_ Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:**

<u>COA Type</u>	<u>Description</u>

**Attachment Check List**

<u>Att Doc Num</u>	<u>Name</u>
402086176	CEMENT BOND LOG
402086180	CEMENT JOB SUMMARY
402086184	WELLBORE DIAGRAM

Total Attach: 3 Files

**General Comments**

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)