

Document Number:
402088800

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Valerie Danson
 Name of Operator: PDC ENERGY INC Phone: (970) 506-9272
 Address: 1775 SHERMAN STREET - STE 3000 Fax: _____
 City: DENVER State: CO Zip: 80203 Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required, Name: _____ Tel: _____
 COGCC contact: Email: _____

API Number 05-123-26314-00 Well Number: 21-13
 Well Name: GUTTERSEN
 Location: QtrQtr: NENW Section: 13 Township: 3N Range: 64W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.230690 Longitude: -104.502060
 GPS Data:
 Date of Measurement: 06/24/2008 PDOP Reading: 1.3 GPS Instrument Operator's Name: HOLLY L. TRACY
 Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: _____
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6809	6815	06/04/2019	B PLUG CEMENT TOP	6544
NIOBRARA	6594	6600	06/04/2019	B PLUG CEMENT TOP	6544

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	698	520	698	0	VISU
1ST	7+7/8	4+1/2	10.5	7,003	915	7,003	0	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6544 with 2 sacks cmt on top. CIBP #2: Depth 4000 with 2 sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 40 sks cmt from 1829 ft. to 1230 ft. Plug Type: CASING Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)
 Set 67 sacks half in. half out surface casing from 902 ft. to 0 ft. Plug Tagged:
 Set _____ sacks at surface
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
 Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Plugging Date: 06/05/2019
 of _____
 *Wireline Contractor: C&J Energy Services *Cementing Contractor: C&J Energy Services
 Type of Cement and Additives Used: Type III 14.8 PPG Portland Cement
 Flowline/Pipeline has been abandoned per Rule 1105 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Guttersen 21-13 (05-123-26314)/Plugging Procedure
 Producing Formation: Niobrara/Codell: 6594'-6815'
 Upper Pierre Aquifer: 660'-1540'
 TD: 7018' PBTD: 6948'
 Surface Casing: 8 5/8" 24# @ 698' w/ 520 sxs cmt
 Production Casing: 4 1/2" 10.5# @ 7003' w/ 915 sxs cmt (TOC @ Surface' - CBL).
 Procedure:
 1. MIRU pulling unit. Pull 2 3/8" tubing.
 2. RU wireline company.
 3. TIH with CIBP. Set BP at 6544'. Top with 2 sxs 15.8#/gal CI G cement.
 4. TIH with CIBP. Set BP at 4000'. Top with 2 sxs 15.8#/gal CI G cement.
 5. TIH with tubing to 1829'. RU cementing company. Mix and pump 40 sxs 14.8#/gal Type III cement down tubing (Pierre coverage from 1800'-1300'). TOC at 1230'.
 6. Pick up tubing to 902'. Mix and pump 67 sxs 14.8#/gal Type III cement down tubing. Cement circulate to surface.
 7. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Valerie Danson
 Title: Reg Tech Date: _____ Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY:

COA Type

Description

--	--

Attachment Check List

Att Doc Num

Name

402088854	CEMENT JOB SUMMARY
402088857	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group

Comment

Comment Date

User Group	Comment	Comment Date
		Stamp Upon Approval

Total: 0 comment(s)