



SRC ENERGY

Reviewed: 6/24/19 CD

Operator: SRC Energy
Well Name: Miller 25-5F
Legal: SWNW, Section 25, Township 4N, Range 66W
Location: Weld County, CO
API: 05-123-16225
Surface: 8.625" 23# @ 516' **Hole Size:** 12.25" **TOC:** Surface
Production: 4.5" 11.6# @ 7,369' **Hole Size:** 7.875" **TOC 1:** 6310' (CBL)
Perforations: 6933'-7122' (Niobrara), 7235'-7,245' (Codell) **TOC 2:** 4224' (CBL)
TD: 7,371'

P&R Procedure

1. Conduct pre-job safety meeting and complete daily JSA
2. Blow down well if necessary, circulate hole with treated water
3. Dig out around wellhead and perform bradenhead test
4. MIRU WO unit, ND wellhead, NU BOP, tally all pipe
5. Set 11.6# CIBP @ 6838'
6. Pressure test casing to 500 psi for 15 minutes.
7. Set 12 sx on top of CIBP (cover 225' above Niobrara top)
8. Pump 23 sx balanced plug @ 4275' MD (300' plug)
9. TIH to 2,500' and perforate casing
10. TIH w/ 4-1/2" 11.6# CICR, set at 2,400'
 - a. Squeeze perms w/ 70 sx (300' annulus plug & 100' casing plug)
 - b. Release off of CICR and set 15 sx on top (200' plug)
11. Cut 4.5" casing at 900' and POOH
12. TIH to 950' and pump stub plug (0' – 950')
 - a. 289 sx of 15.8# class G neat 1.15 cu./ft. yield cement
 - b. 408' out of surface casing
 - c. Wait 4 hours and tag plug
13. RDMO WO unit
14. Dig up wellhead and cut off 10' below restored ground level, top off if necessary
15. Weld on cap with ID plate, inscribed with well location, and identity
16. Backfill, clean location
17. P&R complete