

FORM  
6Rev  
05/18

# State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

402100022

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required.

Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 10110

Contact Name: Renee Kendrick

Name of Operator: GREAT WESTERN OPERATING COMPANY LLC

Phone: (720) 595-2114

Address: 1001 17TH STREET #2000

Fax:

City: DENVER

State: CO

Zip: 80202

Email: rkendrick@gwogco.com

**For "Intent" 24 hour notice required,**

Name: Silver, Randy

Tel: (720) 827-6688

**COGCC contact:**

Email: randy.silver@state.co.us

API Number 05-001-09457-00

Well Name: NORTH COLORADO

Well Number: 12-13

Location: QtrQtr: NENW

Section: 13

Township: 1S

Range: 68W

Meridian: 6

County: ADAMS

Federal, Indian or State Lease Number:

Field Name: SPINDLE

Field Number: 77900

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

### Only Complete the Following Background Information for Intent to Abandon

Latitude: 39.969750

Longitude: -104.953310

GPS Data:

Date of Measurement: 09/30/2010

PDOP Reading: 1.4

GPS Instrument Operator's Name: Tim Wheelock

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 1200

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

### Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	8185	8201			
J SAND	8628	8674			

Total: 2 zone(s)

### Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	1,132	740	1,132	0	CALC
1ST	7+7/8	4+1/2	11.6	8,909	260	8,909	7,400	CBL
			Stage Tool	5,240	175	5,240	4,545	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 8550 with 4 sacks cmt on top. CIBP #2: Depth 8100 with 30 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 30 sks cmt from 5240 ft. to 4840 ft. Plug Type: CASING Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 450 sacks half in. half out surface casing from 1250 ft. to 0 ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
of \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

#### Procedure:

- 1 Contact COGCC 24 hr before MIRU
- 2 MIRU
- 3 Blow down and kill well
- 4 NDWH/NUBOP
- 5 TOO H with Tubing
- 6 RU Wireline set plug at 8550' w/ 4sx
- 7 Set CIBP at 8100'
- 8 TIH pump 30 sx on CIBP
- 9 POOH to 5240' Roll hole clean and pressure test csg to 300psi
- 10 Release flowback separator and flare stack if no longer needed
- 11 Verify all fluid migration has been stopped
- 12 Pump 30sx Class G from 5240' to 4840'
- 13 Cut & pull casing @ 1200'
- 14 Pump 450 sx Class G from 1250' to surface
- 15 RDMO
- 16 Cut & cap casing 4' - 6' below GL w/ plate (Well Name, API, Legal Location)

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Renee Kendrick

Title: Senior Regulatory Analyst Date: \_\_\_\_\_ Email: rkendrick@gwogco.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

**COA Type**

**Description**

--	--

**Attachment Check List**

**Att Doc Num**

**Name**

402100167	WELLBORE DIAGRAM
402100168	WELLBORE DIAGRAM

Total Attach: 2 Files

**General Comments**

**User Group**

**Comment**

**Comment Date**

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)