

**FORM
INSP**Rev
X/15**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

07/25/2019

Submitted Date:

07/26/2019

Document Number:

679704886**FIELD INSPECTION FORM**
 Loc ID 315411 Inspector Name: Moran, Rick On-Site Inspection ☐ 2A Doc Num:
Operator Information:OGCC Operator Number: 6720Name of Operator: ROBERT L BAYLESS PRODUCER LLCAddress: 621 17TH ST STE 2300City: DENVER State: CO Zip: 80293**Status Summary:**☐ THIS IS A FOLLOW UP INSPECTION☒ FOLLOW UP INSPECTION REQUIRED☐ NO FOLLOW UP INSPECTION REQUIRED**Findings:**7 Number of Comments3 Number of Corrective Actions☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Trujillo, Helen		notices@rlbayless.com	All inspections
Kellerby, Shaun	970-712-1248	shaun.kellerby@state.co.us	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
230788	WELL	PR	12/01/2007	GW	103-08457	PHILADELPHIA CREEK-FED 39	PR

General Comment:[COGCC Inspection Report Summary.](#)[On 7-25-2019 at approximately 12:30, inspector Rick Moran, conducted a routine inspection at Robert L Bayless well Philadelphia Creek 39 in Rio Blanco county.](#)[During this inspection the following compliance issues were observed:](#)

- [1\) Stormwater going through location & pit. Photo 2 & 4. Complete by 8-28-2019.](#)
- [2\) Pit < 2' of freeboard. Photo 3. Complete by 8-28-2019.](#)
- [3\) Unmarked deadman. Photo 5. Complete by 8-28-2019.](#)

[A follow up on this site inspection will be conducted to ensure the compliance issues have been corrected to comply with COGCC rules.](#)[This is a summary of inspection report 679704886.](#)

LocationOverall Good: ☒

Signs/Marker:			
Type	WELLHEAD		
Comment:			
Corrective Action:		Date:	
Type	BATTERY		
Comment:			
Corrective Action:		Date:	

Emergency Contact Number:

Comment: 911

Corrective Action:

Date: _____

Overall Good: ☒

Spills:			
Type	Area	Volume	

In Containment: No

Comment:

☐ Multiple Spills and Releases?

Fencing/:			
Type	PIT		
Comment:			
Corrective Action:		Date:	

Equipment:			corrective date
Type: Gas Meter Run	# 1		
Comment:			
Corrective Action:		Date:	
Type: Bird Protectors	# 1		
Comment:			
Corrective Action:		Date:	
Type: Horizontal Heated Separator	# 1		
Comment:			
Corrective Action:		Date:	
Type: Deadman # & Marked	# 4		
Comment:	One fallen deadman.		
Corrective Action:	Install proper guy line markers per Rule 1003.a	Date:	08/28/2019

Venting:

Yes/No	NO		
Comment:			
Corrective Action:		Date:	

Flaring:			
Type			
Comment:			
Corrective Action:		Date:	

--	--	--	--

Inspected Facilities				
Facility ID: 230788	Type: WELL	API Number: 103-08457	Status: PR	Insp. Status: PR
Producing Well				
Comment:	Producing well.			
Corrective Action:				Date:

Reclamation - Storm Water - Pit**Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
Ditches	Fail					
Berms	Fail					

Comment: Sediment is flowing onto the location from the south hillside. That sediment is accumulating on the location and some is flowing further off location to the north.

The south hillside has a ditch & berm along 1/2 of the base that is directing some stormwater away from the location. It appears that ditch has filled with sediment & the berm washed away next to the meter building, pit, and separator.

The fallen deadman appears to be associated with stormwater flow.

Corrective Action: **Install or repair required BMPs per Rule 1002.f.**

Date: 08/28/2019

Pits: ☐ NO SURFACE INDICATION OF PIT

Type: Blowdown Lined: NO Pit ID: Lat: 39.917900 Long: -108.736000

Reference Point: _____ Other: _____ Length: _____ Width: _____

Lining:

Liner Type: _____ Liner Condition: _____

Comment: _____

Corrective Action

Date: _____

Fencing:

Fencing Type: Wildlife Fencing Condition: Adequate

Comment: _____

Corrective Action

Date: _____

Netting:

Netting Type: _____ Netting Condition: _____

Comment: _____

Corrective Action

Date: _____

Anchor Trench Present: _____ Oil Accumulation: NO 2+ feet Freeboard: NO

Comment: Pit has ~18" of freeboard. Evidence of stormwater loading pit with sediment.

Corrective Action

Install or repair required BMPs per Rule 1002.f.

Date: 08/28/2019

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/webblink/>) and search by document number:

Document Num	Description	URL
679704887	inspection photos	http://ogccwebblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4891270