



OIL AND GAS CONSERVATION COMMISSION
OF THE STATE OF COLORADO

SUNDRY NOTICES AND REPORTS ON WELLS

INSTRUCTIONS

Notice must be given to the Director, and approval obtained in advance of the time when the owner or operator expects to recomplete or abandon a well or to change plans. Within thirty (30) days after recompletion, change of plans, or remedial work, a detailed report of the work done and the results obtained shall be submitted on this form in duplicate for wells on Patented and Federal lands, and in triplicate for wells on State lands. In work that affects only rods, pumps or tubing or other routine work such as, but not limited to, cleaning out to previous total depth, no report is necessary.

Notice of Intention to Recomplete	<input type="checkbox"/>	Report of Remedial Work	<input type="checkbox"/>
Notice of Intention to Change Plans	<input type="checkbox"/>	Report of Recompletion	<input type="checkbox"/>
✓ Notice of Intention to Abandon Well	<input checked="" type="checkbox"/>	Other	<input type="checkbox"/>

(Check appropriate space)

LEASE NAME Unit WELL NO. 4 (Formerly Trigood Tetsell #5)

FIELD Divide WILDCAT _____ COUNTY Logan

LOCATION NW/4 NE/4 Section 3 Township 8 N Range 53 W Meridian 6th
(Quarter Quarter)

1980 feet from S Section Line and 659 feet from W Section Line of Lot 2
N or S E or W

(DETAILS OF WORK)

As per attachment

DVR	
WRS	
HHM	
JAM	
FJP	✓
JJD	✓
FILE	

I/We hereby swear (or affirm) that the statements herein made are a full and correct report.

APPROVED:

MAR 11 1966

Date _____
Director Al Rogers

Company Shell Oil Company Date March 7, 1966

Address 1700 Broadway, Denver, Colo. Phone No. 222-8454

By JB Dineen Title Division Exploitation Engineer
(Signature)



RECEIVED
MAR 10 1966

OIL & GAS
CONSERVATION COMMISSION

PLUG AND ABANDONMENT PROGNOSIS
DIVIDE WATERFLOOD UNIT
UNIT NO. 4

PERTINENT DATA:

ELEV:	4072 GR	AFE:	R-7065
KB-CHF:	9'	PBTD:	4729'
T.D.:	4732'		
CASING:	8 3/8" (28#) at 113' w/75 sx		
	5 1/2" (14#) at 4729'		

Last Test: On 12-30-66, tested 3 BOPD and 88 BWPD.

PROPOSED WORK:

1. Pull production equipment.
2. Locate 5 1/2" csg free point. Shoot off and recover.
3. Spot the following cement plugs:
 - (a) 40 sx across Muddy at 4729'.
 - (b) 30 sx across casing stub.
 - (c) 30 sx across bottom of sfc csg at 113'.
 - (d) 10 sx at sfc.
4. Install abandonment marker.
5. Fill out attached form and mail to Division Exploitation Engineer.

D. B. O'Neill

D. B. O'Neill

C. L. Creager

C. L. Creager

R
RHR/djc
2-23-66
Denver, Colorado