


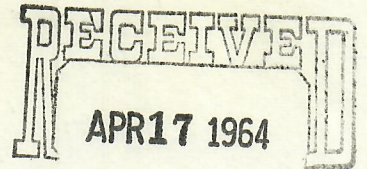

00751754

OIL AND GAS CONSERVATION COMMISSION
OF THE STATE OF COLORADOSUNDRY NOTICES AND REPORTS ON WELLS OIL & GAS
CONSERVATION COMMISSION

INSTRUCTIONS

Notice must be given to the Director, and approval obtained in advance of the time when the owner or operator expects to recomplete or abandon a well or to change plans. Within thirty (30) days after recompletion, change of plans, or remedial work, a detailed report of the work done and the results obtained shall be submitted on this form in duplicate for wells on Patented and Federal lands, and in triplicate for wells on State lands. In work that affects only rods, pumps or tubing or other routine work such as, but not limited to, cleaning out to previous total depth, no report is necessary.

Notice of Intention to Recomplete	<input type="checkbox"/>	Report of Remedial Work	<input type="checkbox"/>
Notice of Intention to Change Plans	<input type="checkbox"/>	Report of Recompletion	<input type="checkbox"/>
<input checked="" type="checkbox"/> Notice of Intention to Abandon Well	<input checked="" type="checkbox"/>	Other	<input type="checkbox"/>

(Check appropriate space)

LEASE NAME _____ Unit _____ WELL NO. 9 W.I. (Formerly Tetsell #4)

FIELD Divide WILDCAT _____ COUNTY Logan

LOCATION Lot 3 NW Section 3 Township 8N Range 53W Meridian 6th

5940 feet from N Section Line and 1963 feet from E Section Line

N or S E or W

(DETAILS OF WORK)

See attached prognosis

DVR	
WRS	
HHM	
JAM	
FJP	<input checked="" type="checkbox"/>
JJD	<input checked="" type="checkbox"/>
FILE	

I/We hereby swear (or affirm) that the statements herein made are a full and correct report.

APPROVED:

APR 22 1964

Date

Director

Company Shell Oil Company Date April 14, 1964Address P.O. Box 2547, Billings, Mont. Phone No. 252-6661By A. S. Jensen Title Div. Exploitation
(Signature) Engr. ✓

PLUG & ABANDONMENT PROGNOSIS
DIVIDE FIELD
UNIT NO. 9-W.I.

Present Status:

TD: 4749

ELEV: 4081 GL

AFE: R-2263 (\$2,500)

Shell's Share: 40.62%

5- $\frac{1}{2}$ ", 14# Csg @ 4744 w/75 sx

8-5/8" Csg @ 119

Perfs:

Muddy 4744-4749 O.H.

Proposed Work:

1. Pull and retire all production equipment.
2. Plug back w/cmt from TD to 4700.
3. Fill hole w/mud.
4. Locate csg "free point". Shoot off above "free point" and pull casing.
5. Spot 25 sx cmt across 5- $\frac{1}{2}$ " stub.
6. Spot 15 sx cmt across bottom of 8-5/8" csg.
7. Cap w/10 sx cmt to surface.
8. Install abandonment marker.
9. Please fill out the attached form and return to Division Exploitation Engineer.

JD

For: *J. T. Ireson*
A. T. Ireson

C. L. Creager
C. L. Creager

Approved: M. H. Whitlatch

TAA/kw *Zaa*
Billings, Montana
April 9, 1964