

FORM

6

Rev
05/18

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

402212086

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER

State: CO

Zip: 80203

Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required,

Name: Santistevan, Brittani

Tel: (720) 471-1110

COGCC contact:

Email: brittani.santistevan@state.co.us

API Number 05-123-19503-00

Well Name: TODD

Well Number: 1

Location: QtrQtr: NESW

Section: 25

Township: 6N

Range: 66W

Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: BRACEWELL

Field Number: 7487

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.457778

Longitude: -104.728056

GPS Data:

Date of Measurement: 01/22/2010

PDOP Reading: 2.2

GPS Instrument Operator's Name: Brandon Lucason

Reason for Abandonment: ☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 1700

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA-CODELL	6902	7164			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	311		311	0	VISU
1ST	7+7/8	4+1/2	11.6	7,197	550	7,197	3,570	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6852 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 100 sks cmt from 1750 ft. to 1500 ft. Plug Type: STUB PLUG Plug Tagged: ☐
Set 160 sks cmt from 511 ft. to 0 ft. Plug Type: OPEN HOLE Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Cut and Cap Date: _____
of _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Todd 1 (05-123-19503) Plugging Procedure (Intent)
Producing Formation: Niobrara/Codell: 6902'-7164'

Upper Pierre Aquifer: 400'-1600'

TD: 7345' PBD: 7249' (6/3/2003)

Surface Casing: 8 5/8" 24# @ 311' w/ ??? sxs

Production Casing: 4 1/2" 11.6# @ 7197' w/ 550 sxs cmt (TOC @ 3570' - CBL)

Tubing: 2 3/8" tubing set @ 7135' (6/3/2003)

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. TIH with CIBP. Set BP at 6852'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Niobrara perms @ 6902')
3. TIH with casing cutter. Cut 4 1/2" casing at 1700'. Pull cut casing.
4. TIH with tubing to 1750'. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Pierre coverage from 1700'-1500').
5. Pick up tubing to 511'. Mix and pump 160 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface (Pierre coverage from 511'-surface). TOOH with tubing.
6. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Valerie Danson

Title: Reg Tech Date: _____ Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

COA Type

Description

--	--

Attachment Check List

Att Doc Num

Name

402212156	WELLBORE DIAGRAM
402212157	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group

Comment

Comment Date

		Stamp Upon Approval
--	--	------------------------

Total: 0 comment(s)