

**FORM
INSP**Rev
X/15**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

11/11/2019

Submitted Date:

11/12/2019

Document Number:

687905817

FIELD INSPECTION FORMLoc ID 311924 Inspector Name: Stewart, Joseph On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**

OGCC Operator Number: 10464

Name of Operator: CATAMOUNT ENERGY PARTNERS LLC

Address: 1801 BROADWAY #1000

City: DENVER State: CO Zip: 80202

Status Summary:

- ☐ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:

8 Number of Comments

2 Number of Corrective Actions

☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Inspections, All		inspections@catamountep.com	All Inspections
Ferrin, Jeremy		jeremy.ferrin@state.co.us	
Pesicka, Conor		conor.pesicka@state.co.us	
Labowskie, Steve		steve.labowskie@state.co.us	COGCC

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
216305	WELL	PR	09/01/2017	GW	067-07911	OLSON-SMITH GAS UNIT 2	PR
295725	WELL	PR	09/12/2017	GW	067-09545	IGE 127	PR

General Comment:

Operator was given corrective actions in previous field inspection reports for other locations (doc#'s 687903685, 687903691, 687904515, 687904515, 687904846, 687905609) for non-compliance and inadequate maintenance of secondary containment. Current liner is inadequate as evident by numerous holes and tears. This inspection is in response to DOC#687903759 on 03/04/2019 when liner had been repaired from previous inspection DOC#687903691. Photos at the end of this inspection report.

LocationOverall Good: ☐**Signs/Marker:**

Type	WELLHEAD		
Comment:	Sign posted at wellhead.		
Corrective Action:		Date:	

Emergency Contact Number:

Comment:	Company contact information posted. Missing local emergency services number or "911" on all signs.		
Corrective Action:	Update sign information per Rule 210.	Date:	12/12/2019

Overall Good: ☐**Spills:**

Type	Area	Volume		
------	------	--------	--	--

In Containment: No

Comment:

☐ Multiple Spills and Releases?**Tanks and Berms:**

Contents	#	Capacity	Type	Tank ID	SE GPS
PRODUCED WATER	2	400 BBLS	STEEL AST		
Comment:					
Corrective Action:					Date:

Paint

Condition	Adequate	
Other (Content)		
Other (Capacity)		
Other (Type)		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Metal	Adequate	Walls Insufficient	Base Insufficient	Inadequate
Comment:	Secondary containment poly tarp liner has multiple tears and holes in liner base and on walls. Tires have been removed, liner is not adequate at time of inspection.			
Corrective Action:	Use adequate material or engineering to make secondary containment sufficiently impervious in order to comply with Rules 605.a(4) and 906.d			Date:

Venting:

Yes/No	NO	
Comment:		
Corrective Action:		Date:

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Inspected FacilitiesFacility ID: 216305 Type: WELL API Number: 067-07911 Status: PR Insp. Status: PR**Producing Well**Comment: [Producing.](#)

Corrective Action:

Date:

Facility ID: 295725 Type: WELL API Number: 067-09545 Status: PR Insp. Status: PR**Producing Well**Comment: [Producing.](#)

Corrective Action:

Date:

Attached DocumentsYou can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
402236831	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4986004
687905818	Olon-Smith GU-2 inspection photos.	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4985999