

FORM

6

Rev  
05/18

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

402252552

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required,

Name: Serna, Abe

Tel: (720) 661-7317

COGCC contact:

Email: abe.serna@state.co.us

API Number 05-123-20225-00

Well Name: HOSHIKO

Well Number: 32-17

Location: QtrQtr: SWNE Section: 17 Township: 5N Range: 64W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.401110

Longitude: -104.571580

GPS Data:

Date of Measurement: 08/21/2010

PDOP Reading: 1.3

GPS Instrument Operator's Name: Holly L. Tracy

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 1480

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

| Formation | Perf. Top | Perf. Btm | Abandoned Date | Method of Isolation | Plug Depth |
|-----------|-----------|-----------|----------------|---------------------|------------|
| CODELL    | 6837      | 6847      |                |                     |            |

Total: 1 zone(s)

## Casing History

| Casing Type | Size of Hole | Size of Casing | Weight Per Foot | Setting Depth | Sacks Cement | Cement Bot | Cement Top | Status |
|-------------|--------------|----------------|-----------------|---------------|--------------|------------|------------|--------|
| SURF        | 12+1/4       | 8+5/8          | 24              | 396           | 360          | 396        | 0          | VISU   |
| 1ST         | 7+7/8        | 4+1/2          | 10.5            | 7,068         | 325          | 7,068      | 3,080      | CBL    |

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6787 with 2 sacks cmt on top. CIBP #2: Depth 6450 with 2 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 80 sks cmt from 1530 ft. to 1280 ft. Plug Type: STUB PLUG Plug Tagged: ☐  
Set 187 sks cmt from 600 ft. to 0 ft. Plug Type: OPEN HOLE Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set \_\_\_\_\_ sacks half in. half out surface casing from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Cut and Cap Date: \_\_\_\_\_  
of \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

#### Technical Detail/Comments:

Hoshiko 32-17 (05-123-20225)/Plugging Procedure (Intent)

Producing Formation: Codell: 6837'-6847'

Upper Pierre Aquifer: 260'-1380'

TD: 7068' PBTD: 6979' (1/15/2018)

Surface Casing: 8 5/8" 24# @ 396' w/ 360 sxs

Production Casing: 4 1/2" 10.5# @ 7068' w/ 325 sxs cmt (TOC @ 3080 - CBL)

Tubing: 2 3/8" tubing set @ 6947' (1/15/2018)

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8 tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6787'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Codell perms @ 6837')
4. TIH with CIBP. Set BP at 6450'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Niobrara @ 6500')
5. TIH with casing cutter. Cut 4 1/2" casing at 1480'. Pull cut casing.
6. TIH with tubing to 1530'. RU cementing company. Mix and pump 80 sxs 15.8#/gal CI G cement down tubing (Pierre coverage from 1480'-1280').
7. Pick up tubing to 600'. Mix and pump 187 sxs 15.8#/gal CI G cement down tubing (Pierre coverage from 600'-surface). Cement should circulate to surface.
8. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Valerie Danson

Title: Reg Tech Date: \_\_\_\_\_ Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

**COA Type**

**Description**

|  |  |
|--|--|
|  |  |
|--|--|

**Attachment Check List**

**Att Doc Num**

**Name**

|           |                  |
|-----------|------------------|
| 402252601 | WELLBORE DIAGRAM |
| 402252602 | WELLBORE DIAGRAM |

Total Attach: 2 Files

**General Comments**

**User Group**

**Comment**

**Comment Date**

|  |  |                     |
|--|--|---------------------|
|  |  | Stamp Upon Approval |
|--|--|---------------------|

Total: 0 comment(s)