

FORM  
6Rev  
05/18

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

402246640

Date Received:

12/10/2019

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 8960

Contact Name: Kate Miller

Name of Operator: BONANZA CREEK ENERGY OPERATING COMPANY

Phone: (720) 440-6116

Address: 410 17TH STREET SUITE #1400

Fax:

City: DENVER State: CO Zip: 80202

Email: regulatory@bonanzacrk.com

For "Intent" 24 hour notice required,

Name: Burns, Adam

Tel: (970) 397-4124

COGCC contact:

Email: adam.m.burns@state.co.us

API Number 05-123-12523-00

Well Name: KAISER

Well Number: 8-3

Location: QtrQtr: SENE Section: 3 Township: 4N Range: 64W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.343280

Longitude: -104.529220

GPS Data:

Date of Measurement: 08/30/2006

PDOP Reading: 1.7

GPS Instrument Operator's Name: Larry Robbins

Reason for Abandonment: ☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 750

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☒ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6802	6814			
NIOBRARA	6526	6692			

Total: 2 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	311	190	311	0	CALC
1ST	7+7/8	4+1/2	11.6	6,918	210	6,918	5,890	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6475 with 25 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 500 sks cmt from 800 ft. to 0 ft. Plug Type: STUB PLUG Plug Tagged: ☒  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 3000 ft. with 40 sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set \_\_\_\_\_ sacks half in. half out surface casing from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Cut and Cap Date: \_\_\_\_\_  
of \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

- 1) MIRU ON LOCATION. ND WH, NU BOP, RU WORK FLOOR, CONTROL WELL, TOOHH WITH 2 3/8TH" TBG
- 2) MIRU WIRELINE AND SET CIBP @ 6475'
- 3) SPOT 25 SX PLUG ON TOP OF PLUG
- 4) TEST CSG. IF CASING DOESN'T TEST SET PLUG ACROSS LEAK.
- 5) RIH AND PERF @ 3000'
- 6) SQUEEZE 40 SX CEMENT, LEAVING 10 SX IN THE CASING
- 7) MIRU WIRELINE. CUT AND PULL CASING FROM 750'
- 8) TIH WITH 2 3/8THS TBG TO 800'.
- 9) MIRU CEMENTERS. ESTABLISH CIRCULATION, PUMP 500 SXS CEMENT TO SURFACE. TOOHH, LAY DOWN TBG
- 10) ND BOP. CUT OFF BELL NIPPLE & CASING TO 4' BELOW GROUND LEVEL. FILL TOP OF CASING WITH READY MIX
- 11) WELD ON PLATE. OPERATOR NAME, API NO., LOCATION
- 12) FILL SURFACE HOLE, MAKING SURE TO REPLACE TOP SOIL LAST
- 13) RIG DOWN AND MOVE OUT ALL EQUIPMENT

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Aubrey Noonan  
Title: Regulatory Analyst Date: 12/10/2019 Email: regulatory@bonanzacr.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Jacobson, Eric Date: 12/11/2019

<u>COA Type</u>	<u>Description</u>
	<p>If there has not been a reported Bradenhead test within 60 days of plugging this well, prior to starting plugging operations, a Bradenhead test shall be performed.</p> <p>1) If, before opening the Bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required, and the COGCC engineering staff must be contacted.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>3) If sampling is required contact COGCC engineering for a confirmation of plugging requirements prior to placing any plugs.</p> <p>Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions.</p> <p>The Form 17 shall be submitted within 10 days of the test.</p>
	<p>1) Provide 48 hour notice of plugging MIRU via electronic Form 42.</p> <p>2) Prior to placing the 800' plug: verify that all fluid migration (liquid or gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>3) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 261' or shallower and provide 10 sack plug at surface.</p> <p>4) Leave at least 100' of cement in the wellbore for each plug.</p> <p>5) Properly abandon on-location flowlines as per Rule 1105. File electronic Form 42 once abandonment is complete. Within 30 days of an operator completing abandonment requirements for an off-location flowline or crude oil transfer line, the operator must submit a Flowline Report, Form 44.</p> <p>6) With the Form 6 SRA operator must provide written documentation which positively affirms each COA has been addressed.</p> <p>7) After placing the shallowest hydrocarbon isolating plug (6475'), operator must wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or of fluid migration, contact COGCC engineering before continuing operations.</p>
	Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.

### Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
402246640	FORM 6 INTENT SUBMITTED
402258922	WELLBORE DIAGRAM
402258923	WELLBORE DIAGRAM

Total Attach: 3 Files

### General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Engineer	Well file verification not completed prior to approval of NOIA.	12/11/2019
Engineer	Deepest Water Well within 1 Mile – 250' SB5 Base of Fox Hills - 271'	12/11/2019
Permit	-Confirmed as-drilled well location. -No other forms in process. -Production reporting up-to-date. -Confirmed productive interval docnum: 1320906. -Reviewed WBDs. -Pass.	12/10/2019

Total: 3 comment(s)