

Inspection Photos

Location Name: ADAMIC 1-20 CA DATE 2-8-20

API#: 05-071-06020

INSP. #: 695101985



Colorado Oil & Gas Conservation Commission
38.3789, -105.12893, 1577.0m, 345°
2020/01/08 12:15:15



Colorado Oil & Gas Conservation Commission
38.37902, -105.12859, 1582.0m, 52°
2020/01/08 12:17:29

PHOTO 1: LOCATION

PHOTO 2: WELL SIGN, CONTACT PHONE NUMBER SIZE IS INADEQUATE AND 911 IS NOT POST ON SIGHT. **INSTALL SIGN THAT COMPLIES WITH RULE 210.d. 24 HOURS TO POST EMERGENCY CONTACT NUMBER. CA DATE 1-9-20**

Inspection Photos

Location Name: ADAMIC 1-20 CA DATE 2-8-20

API#: 05-071-06020

INSP. #: 695101985



PHOTO 3: IT APPEARS THAT WELLHEAD IS LEAKING PRODUCED OIL, AREA OF IMPACTED SOIL APP. 6' BY 3' AROUND WELLHEAD.

Securely fasten all valves, pipes, and fittings to ensure good mechanical condition, inspect at regular intervals and maintain in good mechanical condition per Rule 605.d. Properly treat or dispose of oily waste in accordance with 907.e." CA DATE 2-8-20.

PHOTO 4: A BULLPLUG ON 210 BBL TANK IS LEAKING. THERE IS AN AREA OF IMPACTED SOIL APP. 3' BY 6' NEAR LEAKING PLUG. CALLED CONTACT NUMBER POSTED ON BATTERY SIGN AND HAD TO LEAVE A MESSAGE.

Securely fasten all valves, pipes, and fittings to ensure good mechanical condition, inspect at regular intervals and maintain in good mechanical condition per Rule 605.d. Properly treat or dispose of oily waste in accordance with 907.e." 24 HOURS TO REPAIR LEAKING BULLPLUG 30 DAYS FOR SOIL. CA DATE 1-9-20.

Inspection Photos

Location Name: ADAMIC 1-20 CA DATE 2-8-20

API#: 05-071-06020

INSP. #: 695101985



PHOTO 5: VALVE ON 210 BBL TANK IS SEEPING. THERE IS AN AREA OF IMPACTED SOIL APP. 3' BY 1' NEAR SEEPING VALVE.. *Securely fasten all valves, pipes, and fittings to ensure good mechanical condition, inspect at regular intervals and maintain in good mechanical condition per Rule 605.d. Properly treat or dispose of oily waste in accordance with 907.e. CA DATE 2-8-20.*

PHOTO 6: LOADOUT LINE IS PLUMBED OUTSIDE SECONDARY BMP. THERE IS AN AREA OF IMPACTED SOIL OUSIDE OF BURM) APP. 1' BY 2' AROUND LOADOUT. *INSTALL SECONDARY BMP TO PREENT OILY WASTE FROM MIXING WITH STORM WATER PER RULE 1002.f. Properly treat or dispose of oily waste in accordance with 907.e. CA DATE 2-8-20.*

Inspection Photos

Location Name: ADAMIC 1-20 CA DATE 2-8-20

API#: 05-071-06020

INSP. #: 695101985



**PHOTO 7: APPEARS THAT GEAR BOX ON PUMPJAKE IS LEAKING,
THERE IS AN AREA OF IMPACTED SOIL BENEATH GEARBOX.**

**Securely fasten all valves, pipes, and fittings to ensure good
mechanical condition, inspect at regular intervals and maintain in
good mechanical condition per Rule 605.d. Properly treat or
dispose of oily waste in accordance with 907.f. CA DATE 2-8-20.**