

Engineer: Christina Cordaro
Cell Phone Number: 432-209-1371

PLUG and ABANDONMENT PROCEDURE

DUNKLEE #1

API 05-069-06178

Description

1. Well is being re-entered to P&A well to current standards due to it being offset to upcoming fracs.
2. Provide 48-hour notice to COGCC prior to rig up per request on approved Form 6 (e.g. submit Form 42, etc.).
3. Locate and expose 8 5/8" casing stub. Extend stub to 12" below GL and install 8 5/8"x 11" SOW, 3M casing head with 3000 psi ball valves in both outlets.
4. Prepare location for base beam equipped rig. Install perimeter fence as needed. Spot in 6200' of 3-1/2" work string (WS) to location.
5. MIRU Spud rig. NU 9" 3000 psi BOP stack on casing head. PT BOP and casing head. Function test BOP. Install a choke manifold on casing outlet. NU rotating head on BOP. Hook up return line to shale shaker. Ensure full opening 3-1/2" TIW on rig floor.
6. PU 7-7/8" PDC bit, 6-1/2" mud motor, X-Over to workstring.
7. TIH and drill through 10 sx cement plug at surface. Once past cement plug and no cement is seen in returns, perform flow test.
8. Continue drilling to next 25 sx cement plug. TOC estimated to be at 168'. BOC estimated at 260' Once past cement plug and no cement is seen in returns, perform flow test.
9. Continue drilling until reaching 6200'. Top of casing stub should be at 6320'
10. TOOH. LD Workstring. Remove bit and mud motor. TIH workstring with mule shoe to previous TD.
11. RU Cementers. Pump Niobrara Balanced Plug: 180 sx (275 cf, 49bbl) 15.8 ppg & 1.53 cf/sk cement with 0.25 lb/sk Polyflake. Volume is based on 400' in the 7-7/8" drill bit size with 100% excess. Cement will be from 6200'-5800'. RD cementers.
12. Slowly pull out of the cement and PUH to 5500'. Circulate to ensure no cement is left in the WS.
13. WOC per cement company recommendation. TIH and tag cement. Cement top needs to be at or above 5800'. Call Engineering if tag is lower.
14. LD WS while TOOH to 3910'.
15. RU Cementers. Pump Sussex Balanced Plug: 155 sx (275 cf, 49 bbl) 12 ppg cement with & 1.79 cf/sk cement with 0.25 lb/sk Polyflake. Volume is based on 400' in the 7-7/8" drill bit size with 100% excess. Cement will be from 4260'-3860'. RD cementers.
16. Slowly pull out of the cement and PUH to 2800'. Circulate to ensure no cement is left in the WS.
17. WOC per cement company recommendation. TIH and tag cement. Cement top needs to be at or above 3510'. Call Engineering if tag is lower.
18. LD WS while TOOH to 420'.
19. RU Cementers. Pump Surface Shoe Plug: 150 sx (232 cf, 41.5 bbl) 14 cement ppg with & 1.55 cf/sk cement with 0.25 lb/sk Polyflake. Volume is based on 212' in the 7-7/8" drill bit size with 100% excess and 208' inside 8-5/8", 24#/ft surface casing with no excess. Cement will be from 420-10'. RDMO Cementers.
20. Slowly pull out of the cement and PUH to 10'. Circulate to ensure no cement is left in the WS or above 10' in the casing.
21. TOOH, laying down remainder of WS.

22. WOC per cement company recommendation.
23. Document if cement is circulated to surface. If cement is not circulated to surface, contact engineer.
24. Instruct cementing and wireline contractors to e-mail copies of all job logs/job summaries to rscDJVendors@anadarko.com within 24 hours of completion of the job.
25. Supervisor submit paper copies of all invoices, logs, and reports to Platteville Engineering Specialist
26. Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.
27. Capping crew will set and secure night cap on 8 5/8" casing head to restrain the casing head, pressure test CIBP to 500 psi with hydrotest pump, then remove night cap and casing head restraints.
28. Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
29. Welder cut casing minimum 5' below ground level.
30. Fill casing to surface using 4500 psi compressive strength cement (NO gravel).
31. Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
32. Obtain GPS location data as per COGCC Rule 215 and send to rscDJVendors@anadarko.com.
33. Properly abandon flow lines per Rule 1103. File electronic Form 42 once abandonment is complete.
34. Back fill hole with fill. Clean location, and level.
35. Submit Form 6 to COGCC ensuring to provide 'As performed' WBD identifying operations completed.