

Inspection Photos
Operator: BP America
Location/API #: 067-05796
Date: 1-22-2020



Photo 1. View of stormwater controls installed within the northern project area. Cobble rock at outlet is not adequate outlet structure. Bare soils are not stabilized.



Photo 2. View of berm installed within the northern project area. Berm is not stabilized.



Photo 3. View of seed placed on soil surface, although seedbed is not prepared and seed is not incorporated into soil. Stabilizing measures such as hydromulch or straw mulch are needed until stabilized with perennial vegetation.



Photo 4. View of berm installed within the southwestern project area. Bare soils not stabilized, seed bed not prepared and seed not incorporated.



Photo 5. View of silt trap installed within the western project area. Geotextile fabric not in place. Insufficient rock armoring.