

FORM
6Rev
02/20

State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Replug By Other Operator

Document Number:

402340734

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: <u>5</u>	Contact Name: <u>Dave Andrews</u>
Name of Operator: <u>COLORADO OIL & GAS CONSERVATION</u>	Phone: <u>(303) 894-2100 x5686</u>
Address: <u>1120 LINCOLN ST SUITE 801</u>	Fax: _____
City: <u>DENVER</u> State: <u>CO</u> Zip: <u>80203</u>	Email: <u>david.andrews@state.co.us</u>
For "Intent" 24 hour notice required, Name: <u>Moran, Rick</u> Tel: <u>(720) 827-6689</u> COGCC contact: Email: <u>rick.moran@state.co.us</u>	

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number <u>05-103-10954-00</u>	Well Number: <u>6-16</u>
Well Name: <u>ANDERSON (OWP)</u>	
Location: QtrQtr: <u>SENW</u> Section: <u>16</u> Township: <u>1N</u> Range: <u>95W</u> Meridian: <u>6</u>	
County: <u>RIO BLANCO</u>	Federal, Indian or State Lease Number: _____
Field Name: <u>POWELL PARK</u>	Field Number: <u>69900</u>

Only Complete the Following Background Information for Intent to Abandon

Latitude: <u>40.056144</u>	Longitude: <u>-108.059128</u>
GPS Data: GPS Quality Value: <u>6.0</u> Type of GPS Quality Value: _____	Date of Measurement: <u>01/22/2007</u>
GPS Instrument Operator's Name: <u>J KIRKPATRICK</u>	
Reason for Abandonment: <input type="checkbox"/> Dry <input type="checkbox"/> Production Sub-economic <input type="checkbox"/> Mechanical Problems	
<input checked="" type="checkbox"/> Other <u>OWP Well</u>	
Casing to be pulled: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	Estimated Depth: _____
Fish in Hole: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If yes, explain details below
Wellbore has Uncemented Casing leaks: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If yes, explain details below
Details: _____	

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth

Total: 0 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
CONDUCTOR	24	20	50	80		80	0	VISU
SURF	17+1/2	13+3/8	54.5	553	550	553	0	VISU
1ST	12+1/4	9+5/8	40	3,075	800	3,075	0	VISU
2ND	7+7/8	4+1/2	11.6	10,270	1,260	10,270	6,570	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 10220 with 2 sacks cmt on top. CIPB #2: Depth 553 with 50 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIPB #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 40 sks cmt from 7700 ft. to 7200 ft. Plug Type: CASING Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 4974 ft. with 100 sacks. Leave at least 100 ft. in casing 4924 CICR Depth

Perforate and squeeze at 3125 ft. with 40 sacks. Leave at least 100 ft. in casing 3075 CICR Depth

Perforate and squeeze at 2083 ft. with 100 sacks. Leave at least 100 ft. in casing 2033 CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set 165 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Cut and Cap Date: _____
of _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

This well is an OWP Plugging Project.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Shannon Chollett

Title: OWP Engineer Date: _____ Email: shannon.chollett@state.co.us

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

COA Type **Description**

--	--

Attachment Check List

Att Doc Num **Name**

402340759 WELLBORE DIAGRAM

Total Attach: 1 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)