

**FORM  
INSP**Rev  
X/15**State of Colorado  
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

05/12/2020

Submitted Date:

05/19/2020

Document Number:

700900083**FIELD INSPECTION FORM**Loc ID 320156 Inspector Name: Finkenbinder, Chane On-Site Inspection ☐ 2A Doc Num: \_\_\_\_\_**Operator Information:**OGCC Operator Number: 19035Name of Operator: OVERLAND RESOURCES LLCAddress: SUITE C18 PMB 440City: GREENWOOD State: CO Zip: 80121**Status Summary:**☐ THIS IS A FOLLOW UP INSPECTION☒ FOLLOW UP INSPECTION REQUIRED☐ NO FOLLOW UP INSPECTION REQUIRED**Findings:**14 Number of Comments8 Number of Corrective Actions☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM  
PREVIOUS INSPECTIONS THAT HAVE NOT  
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Anderson, Robert	(303) 800-6175	admin@overlandresourcesllc.com	

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
202852	WELL	SI	07/01/2017	OW	001-08257	THOMPSON-PRICE 2	SI

**General Comment:**

Location			
<b>Lease Road:</b>			
Type	Access		
comment:	Adequate		
Corrective Action	L		Date:
Overall Good: <input checked="" type="checkbox"/>			
<b>Signs/Marker:</b>			
Type	BATTERY		
Comment:	Sign or label not posted or information inaccurate on tanks or containers No placards on Crude tanks, Pro Water tank, or Pump Jack		
Corrective Action:	Install sign to comply with Rule 210.d. Corrective action Date 6/15/2020 see photo# 1 & 4		Date: 06/15/2020
Type	WELLHEAD		
Comment:	Sign or label not posted or information inaccurate on tanks or containers No placards on Crude tanks, Pro Water tank, or Pump Jack		
Corrective Action:	Install sign to comply with Rule 210.d. Corrective action Date 6/15/2020 see photo# 1 & 4		Date: 06/15/2020
Type	TANK LABELS/PLACARDS		
Comment:	Sign or label not posted or information inaccurate on tanks or containers No placards on Crude tanks, Pro Water tank, or Pump Jack		
Corrective Action:	Install sign to comply with Rule 210.d. Corrective action Date 6/15/2020 see photo# 1 & 4		Date: 06/15/2020
Emergency Contact Number:			
Comment:	Adequate		
Corrective Action:			Date: _____
Overall Good: <input type="checkbox"/>			
<b>Spills:</b>			
Type	Area	Volume	
In Containment: No			
Comment: _____			
<input type="checkbox"/> Multiple Spills and Releases?			
<b>Equipment:</b>			
Type: Pump Jack	# 1		corrective date
Comment:	Stained soil around Pump Jack motor and gear box.		
Corrective Action:	Properly treat or dispose of oily waste in accordance with 907.e. Corrective action Date 6/15/2020, see photo# 7		Date: 06/15/2020
Type: Bird Protectors	# 2		
Comment:			
Corrective Action:			Date:
Type: Bradenhead	# 1		
Comment:	Appears to be plumbed to surface		
Corrective Action:			Date:

Type: Vertical Heated Separator	# 1	
Comment:		
Corrective Action:		Date:
Type: Emission Control Device	# 1	
Comment:		
Corrective Action:		Date:
Type: Deadman # & Marked	# 4	
Comment:		
Corrective Action:		Date:

**Tanks and Berms:**

Contents	#	Capacity	Type	Tank ID	SE GPS
PRODUCED WATER	1	OTHER	Open Top		,
Comment:	Soiled soil around Produced water tanks. Stained soil under load out line to produced water tank.				
Corrective Action:	Properly treat or dispose of oily waste in accordance with 907.e. Corrective action Date 6/15/2020, see photo# 2				Date: 06/15/2020

**Paint**

Condition	Adequate
Other (Content)	
Other (Capacity)	
Other (Type)	

**Berms**

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Earth	Inadequate	Walls Insufficient	Base Insufficient	Inadequate
Comment:	Shares berm with crude tanks			
Corrective Action:	Repair or install berms or other secondary containment devices per Rule 605.a.(4). Inadequate berms around tank(s) Corrective action Date 6/15/2020, see photo# 1 & 4			Date: 06/15/2020

Contents	#	Capacity	Type	Tank ID	SE GPS
CRUDE OIL	2	300 BBLS	STEEL AST		39.811432,-104.207511
Comment:	Soiled soil around Produced water tanks. Stained soil under load out line to produced water tank. Bull plug missing from loadoff line.				
Corrective Action:	Properly treat or dispose of oily waste in accordance with 907.e. Corrective action Date 6/15/2020, see photo# 2 Location is within a designated setback location, bullplug or cap all loadlines per Rule #604.c.(2)O. Corrective action Date 5/25/2020 , see photo# 3				Date: 06/15/2020

**Paint**

Condition	Adequate
Other (Content)	
Other (Capacity)	
Other (Type)	

**Berms**

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Earth	Inadequate	Walls Insufficient	Base Insufficient	Inadequate

Comment:	Inadequate berms around tank(s), and separator		
Corrective Action:	Repair or install berms or other secondary containment devices per Rule 605.a.(4). Inadequate berms around tank(s) Corrective action Date 6/15/2020, see photo# 1 & 4	Date:	06/15/2020

**Venting:**

Yes/No	NO		
Comment:			
Corrective Action:		Date:	

**Flaring:**

Type		
Comment:		
Corrective Action:		Date:

**Inspected Facilities**

Facility ID: 202852 Type: WELL API Number: 001-08257 Status: SI Insp. Status: SI

**Idle Well**

Purpose: ☒ Shut In ☐ Temporarily Abandoned

Reminder: \_\_\_\_\_

Comment: SI

Corrective Action: \_\_\_\_\_

Date: \_\_\_\_\_

**BradenHead**

Comment: Appears to be plumbed to surface

Corrective Action: \_\_\_\_\_

Date: \_\_\_\_\_

**COGCC Comments**

Comment	User	Date
<p>COGCC Inspection Report Summary</p> <p>On Tuesday May 12, 2020 at approximately 10:00 am I, Inspector Chane Finkenbinder conducted an onsite inspection at the Thompson Price #2 Overland Resources LLC 001-08257 in Adams County Colorado.</p> <p>While there, I observed Shut in well</p> <p>Sign or label not posted or information inaccurate on tanks or containers</p> <p>No placards on Crude tanks, Pro Water tank, or Pump Jack</p> <p>Install sign to comply with Rule 210.d. Corrective action Date 6/15/2020 see photo# 1 &amp; 4</p> <p>Stained soil around Pump Jack motor and gear box</p> <p>Properly treat or dispose of oily waste in accordance with 907.e. Corrective action Date 6/15/2020, see photo# 7</p> <p>Soiled soil around Produced water tanks. Stained soil under load out line to produced water tank. Properly treat or dispose of oily waste in accordance with 907.e. Corrective action Date 6/15/2020, see photo# 2</p> <p>Bull plug missing from loadoff line. Location is within a designated setback location, bullplug or cap all loadlines per Rule #604.c.(2)O. Corrective action Date 5/25/2020 , see photo# 3</p> <p>Inadequate berms around tank(s)</p> <p>Repair or install berms or other secondary containment devices per Rule 605.a.(4).</p> <p>Inadequate berms around tank(s) Corrective action Date 6/15/2020, see photo# 1 &amp; 4</p> <p>Repair or install berms or other secondary containment devices per Rule 605.a.(4).</p> <p>Corrective action Date 6/15/2020, see photo# 6</p> <p>A follow up on this site inspection needs to be conducted to ensure the compliance issues have been corrected to comply with COGCC rules.</p> <p>This is a summary of inspection report.</p>	finkenbc	05/19/2020

**Attached Documents**

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
700900084	Inspection photos	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5154577">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5154577</a>