

FORM
6
Rev
02/20

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
Document Number: 402401652			
Date Received: 05/20/2020			

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 10110 Contact Name: Kapri McMillan
 Name of Operator: GREAT WESTERN OPERATING COMPANY LLC Phone: (970) 364-2826
 Address: 1001 17TH STREET #2000 Fax: _____
 City: DENVER State: CO Zip: 80202 Email: kcmcmillan@gwp.com

For "Intent" 24 hour notice required, Name: Santistevan, Brittani Tel: (720) 471-1110
COGCC contact: Email: brittani.santistevan@state.co.us

Type of Well Abandonment Report: Notice of Intent to Abandon Subsequent Report of Abandonment

API Number 05-123-24312-00
 Well Name: GREAT WESTERN Well Number: 27-13
 Location: QtrQtr: SWSW Section: 27 Township: 6N Range: 67W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.453640 Longitude: -104.887810
 GPS Data: GPS Quality Value: 2.4 Type of GPS Quality Value: _____ Date of Measurement: 09/13/2007
 GPS Instrument Operator's Name: L. ROBBINS

Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____

Casing to be pulled: Yes No Estimated Depth: 2500
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7221	7242	01/22/2017	BRIDGE PLUG	6792
NIOBRARA	6904	7046	01/22/2017	BRIDGE PLUG	6792
Total: 2 zone(s)					

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	460	380	460	0	VISU
1ST	7+7/8	4+1/2	11.6	7,385	160	7,385	6,310	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth _____ with _____ sacks cmt on top. CIPB #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIPB #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 25 sks cmt from 6792 ft. to 6356 ft. Plug Type: CASING Plug Tagged:
Set 10 sks cmt from 4200 ft. to 4070 ft. Plug Type: CASING Plug Tagged:
Set 45 sks cmt from 2550 ft. to 2300 ft. Plug Type: STUB PLUG Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at 4300 ft. with 50 sacks. Leave at least 100 ft. in casing 4200 CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)

Set 375 sacks half in. half out surface casing from 1200 ft. to 0 ft. Plug Tagged:

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Cut and Cap Date: _____
of _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 Yes No

Technical Detail/Comments:

Procedure:

- 1 Contact COGCC
- 2 MIRU
- 3 Blow down and kill well
- 4 NDWH/NUBOP
- 5 Roll hole clean
- 6 Pump 25 sx Thermal 35 on top of plug @ 6792'
- 7 TOOH w/ tubing, stand back
- 8 RIH w/ WL and shoot holes at 4300' and 4100'
- 9 RIH and set CICR @ 4200'
- 10 Squeeze 50 sx thru CICR, leave additional 10 sx on top Class G
- 11 Roll hole clean
- 12 Release flowback if no longer needed
- 13 Cut & pull casing @ 2500'
- 14 Pump stub plug from 2550' w/ 45 sx AGM (1.86ft3/sx) (est TOC @ 2300')
- 15 WOC 4 hours, tag plug, check for migration
- 16 PU to 1200' and pump 375 sx Class G to surface
- 17 WOC 4 hours
- 18 RIH tag, top off w/ cement as needed
- 19 RDMO
- 20 Cut & cap casing 4' - 6' below GL w/ plate (Well Name, API, Legal Location)

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: Renee Kendrick

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: JENKINS, STEVE

Date: 6/2/2020

CONDITIONS OF APPROVAL, IF ANY:

Expiration Date: 12/1/2020

COA Type**Description**

	<p>For Wells with known Bradenhead pressures:</p> <ol style="list-style-type: none"> 1) Provide 48-hour notice of plugging MIRU via electronic Form 42. 2) The plug at 2550' needs to be placed and have an 8-hour WOC to assure that all fluid migration has been stopped. If that doesn't isolate the flow, additional attempts in front of the surface shoe plug will need to be attempted. Other downhole potential squeeze opportunities may need to be looked at before the 1200' plug. 3) Prior to placing the 1200' plug: verify that all fluid migration (liquid or gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders. 4) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 410' or shallower and provide 10 sx plug at the surface. Leave at least 100' of cement in the casing for each plug. 5) Properly abandon flowlines as per Rule 1105. File electronic Form 42 once abandonment is complete. Within 30 days of an operator completing abandonment requirements for an off-location flowline or crude oil transfer line, the operator must submit a Flowline Report, Form 44. 6) With the Form 6 SRA operator must provide written documentation which positively affirms each COA has been addressed. 7) After placing the shallowest hydrocarbon isolating plug (2550'), operator must wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or of fluid migration, contact COGCC engineering before continuing operations.
	Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.
	<p>Prior to starting plugging operations a Bradenhead test shall be performed if there has not been a reported Bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <ol style="list-style-type: none"> 1) If, before opening the Bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required. 2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required. <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the COGCC within three (3) months of collecting the samples.</p>

Attachment Check List**Att Doc Num****Name**

402401652	FORM 6 INTENT SUBMITTED
402401740	WELLBORE DIAGRAM
402401741	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Engineer	1) Deepest Water Well within 1 mile = 300'. 2) Fox Hills Bottom- N/A, per SB5.	06/02/2020
Engineer	In accordance with the Notice to Operators (NTO): Timing for COGCC Forms adopted on 05/01/2020, this Form 6 Notice of Intent to Abandon is valid for 12 months from the date of approval expiring on 06/02/2021. This NTO does not alter the deadlines for submission of, or compliance with any other Commission rule or Form.	06/02/2020
Permit	•Permitting review complete and task passed.	06/01/2020
Permit	•Returned to draft at Operator's request.	05/20/2020

Total: 4 comment(s)