



### Daily Operations

Well Name: HKS 06-23

#### Daily Operations

Well Name	API	Job Type	Start Date	Summary
HKS 06-23	05-123-26974	PLUG AND ABANDON	6/10/2019	crew travel to location safety meeting. spot in ranger rig 5531 and support equipment rig up ranger rig 5531 and support equipment, 1400psi casing 1400psi tubing 0psi surface casing blow down well, kill well with 80bbbls fresh water with biocide down casing and 30bbbls fresh water with biocide down tubing, nd 5k top flange nu 5k bops ru work floor unland tubing at 28,000k, tally out 236 joints of 2 3/8 4.7# tubing 7290.93. miru spn wireline rih with jb gr 7050' pooh rih with CTS cibp setting at 7020' pooh rdmo spn wireline. swifn clean up location, crew travel
HKS 06-23	05-123-26974	PLUG AND ABANDON	6/11/2019	crew travel to location safety meeting. 0psi casing 0psi surface casing trip in tagging cibp with 228 joints 6' in lay down 1 joint eot at 7014', roll hole clean with 130bbbls fresh water with biocide, miru ranger cementers hold safety meeting pressure test lines to 1000psi test good mix and pump 4.09bbbls slurry 20 sacks class g neat 15.8# 1.15y cement followed by 26bbbls fresh water for displacement rd ranger cementers, trip out 30 joints 2 3/8 4.7# tubing reverse clean pressure test casing to 1000psi for 15 minutes test good does not bleed off any pressure, trip out 116 joints 2 3/8 4.7# tubing leaving 81 joints in hole eot at 2500' catch circulation with 4bbbls fresh water with bio, ru ranger cementers mix and pump 8.19bbbls slurry 40 sacks class g neat 15.8# 1.15y cement followed by 7.4bbbls fresh water for displacement, rd ranger cementers, trip out 45 joints 2 3/8 4.7# tubing leaving 36 joints 2 3/8 4.7# tubing eot at 1088' catch circulation with 3bbbls fresh water with biocide, ru ranger cementers mix and pump 16bbbls slurry 78 sacks class g neat 15.8# 1.15y to surface rd ranger cementers, trip out 36 joints of 2 3/8 4.7# tubing rd work floor nd bops top off well with 10 sacks class g neat 15.8# 1.15y cement clean cementers and rig equipment, rdmo ranger cementers rig down ranger rig 5531 and support equipment clean location, crew travel