

FORM

6

Rev  
02/20

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

402419896

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required,

Name: Peterson, Tom

Tel: (970) 370-1281

COGCC contact:

Email: tom.peterson@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-19860-00

Well Name: KIRBY

Well Number: 29-11

Location: QtrQtr: NWNW Section: 29 Township: 4N Range: 67W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.289250 Longitude: -104.921390

GPS Data: GPS Quality Value: 2.1 Type of GPS Quality Value: Date of Measurement: 09/26/2007

GPS Instrument Operator's Name: Holly L. Tracy

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☐ Yes ☒ No Estimated Depth:Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA-CODELL	7018	7328			

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	429	310	429	0	VISU
1ST	7+7/8	4+1/2	10.5	7,458	150	7,458	6,486	CBL
S.C. 1.1				6,486	554	6,486	0	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6968 with 2 sacks cmt on top. CIBP #2: Depth 2500 with 2 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 132 sacks half in. half out surface casing from 1700 ft. to 0 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Cut and Cap Date: \_\_\_\_\_  
of \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

Kirby 29-11 (05-123-19860)/Plugging Procedure (Intent)

Producing Formation: Niobrara/Codell: 7018'-7328'

Upper Pierre Aquifer: 200'-1600'

TD: 7492' PBTD: 7445' (6/7/2017)

Surface Casing: 8 5/8" 24# @ 429' w/ 310 sx cmt

Production Casing: 4 1/2" 10.5# @ 7458' w/ 150 sx cmt (TOC @ 6486' - CBL)

Annular Fill @ 6486' w/ 554 sxs cmt (TOC @ surface - CBL)

Tubing: 2 3/8" tubing set @ 7295' (6/8/2017)

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6968'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Nio perms @ 7018')
4. TIH with CIBP. Set BP at 2500'. Top with 2 sxs 15.8#/gal CI G cement.
5. TIH with tubing to 1700'. RU cementing company. Mix and pump 132 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
6. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Valerie Danson

Title: Reg Tech Date: \_\_\_\_\_ Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

**COA Type**

**Description**

--	--

**Attachment Check List**

**Att Doc Num**

**Name**

402419897	WELLBORE DIAGRAM
402419898	WELLBORE DIAGRAM

Total Attach: 2 Files

**General Comments**

**User Group**

**Comment**

**Comment Date**

		Stamp Upon Approval
--	--	------------------------

Total: 0 comment(s)