

Cementing - Rocky Mountain Division

P.O. BOX 827 - VERNAL UT, 84078 - (435) 789-7407

COMPANY NAME: LARAMIE ENERGY

DATE: 7/9/20

LEASE NAME: HORSESHOE CANYON 3-28

COUNTY: MESA, COLORADO

RIG NO: ENSIGN 319

DESCRIPTION	TIME	RATE	PSI	VOLUME
ON LOCATION	7:15			
WELL NOT KILLED JUST YET	7:17			
TUBING STILL IN HOLE	7:17			
C.I.B.P NOT SET	7:17			
SPOT PUMP AND BULK TRUCK	7:35			
RIG UP SAFETY MEETING	7:40			
RIG START TRIPPING OUT TUB	7:41			
START RIG UP	7:45			
RIG BLOW SOME HYD HOSES	7:50			
RIG STOP TRIPPING PIPE	7:51			
RIG START FIXING HOSES	7:55			
RIG CONT TRIPPING PIPE OUT	8:45			
!!TUBING BLOW OUT OF HOLE!!	9:06			
2 STANDS WITH T.I.W ON END				
I ASK COMP MAN WHAT HAPPENED	9:10			
ANSWER WAS THE TUB WAS BLOWN	9:15			
WING GAS SO THE RIG CREW WAS				
INTRUCTED TO SHUT T.I VALVE &				
PUMP FLUID DOWN CASING TO				
KILL THE WELL, APPARENTLY THE				
FORMATION DIDN'T TAKE WHAT				
RIG WAS PUMPING, PRESSURED UP				
AND HYDRAULICALLY PUSHED				
PIPE OUT OF HOLE.				
RIG CREW TRY TO GET PIPE OUT	9:30			
OF DEREK				
RIG GOT ONE JOINT CUT APART	10:30			
RIG CONT TRIPPING PIPE OUT	11:30			
RIG BLOW ANOTHER HYD HOSE	11:39			
WIRELINE R.I.H W. GAUGE RING	12:17			
TO MAKE SURE CASING IS CLEAR				
WIRELINE R.I.H WITH C.I.B.P	12:50			
C.I.B.P SET @ 2,600'	13:08			
COMP MAN MAKES RIG CREW HOOK	13:20			
TO CSG AND FILL HOLE WITH FLOW				
BACK H2O FROM RIG FLOWBACK				
TANK WITH NO TUB IN HOLE				
HOLE IS FULL	13:48			
HOOK CMT PUMP TO 5.5 CSG	13:49			
PSI TEST 5 1/2 CASING	13:53	0.7	0-410	0.5
"	13:58	0	400	"
"	14:03	0	390	"
PASS PSI TEST/BLEED OFF	14:08	0	390-0	"
RIG START R.I.H WITH TUBING	14:20			
SAFETY MEETING	14:45			
PLUG #1 E.O.T/C.I.B.P @ 2,600'				
FILL HOLE H2O	14:51	1.6	110	0
END	14:51	1.6	110	1

Operator: WYATT CHAPMAN

ACCEPTED AND APPROVED BY:

PROPETRO

JOB LOG

TICKET NUMBER:WC-52

Cementing - Rocky Mountain Division

P.O. BOX 827 - VERNAL UT, 84078 - (435) 789-7407

COMPANY NAME:LARAMIE ENERGY

DATE: 7/9/20

COUNTY:MESA,CO

LEASE NAME:HORSESHOE CANYON 3-28


RIG NO: ENSIGN 319

DECRPTION	TIME	RATE	PSI	VOLUME
START CMT 10 SACKS @ 15.8LB	14:54	1.5	110	0
END CMT 84' PLUG	14:55	2.6	220	2
START DISP WITH H2O E	14:55	2.6	220	0
END DISP .6BBLS EARLY LET SUCK	14:58	3.2	320	9.6 TOTAL
P.O.O.H	15:00			
WASH UP	15:00			
RELEASED FROM LOCATION	15:15			
TOLD TO ARRIVE MON MORN @09:00				
ARRIVE MONDAY 7/13/20	8:34			
SPOT BULK TRUCK	8:35			
PUMP DEAD/HOOK UP JUMPER CALBES	8:40			
SAFETY MEETING	8:45			
WIRESLINE ALREADY PERFED @ 2,175'				
RIG CREW TRIED TO INJECT				
PSI LOCKED UP ON RIG PUMP			500	
INSTRUCTED TO NOT DO INJ RATE	8:50			
JUST FILL HOLE AND BALANCE 30SKS				
WITH 2% CALC2 OVER PERFS				
RIG WILL P.O.O.H AND WAIT TO TAG				
START PUMP/PRIME UP	8:56	9	300	10
PLUG #2 PERFS 2,175'/E.O.T 2,229'				
FILL HOLE WITH H2O	9:01	1.5	120	0
END	9:02	1.5	140	1
START CMT 30 SACKS W.2%CALC2	9:08	1.4	140	0
END CMT 256.3' PLUG	9:10	2.9	190	6.1
START DISP WITH H2O	9:10	2.9	190	0
END DISPLACEMENT WATCH SUCK	9:13	2.9	360	7/7.5 TOTAL
P.O.O.H, WAIT TO TAG PLUG	9:15			
WIRESLINE R.I.H TO TAG PLUG	11:20			
SHOULD TAG @1,927.7'				
TAGGED @ 1,942'	11:30			
PERF @500'	11:35			
HOOK TO 5.5 PUMP GREEN DYE H2O	11:44	1.6	0	0
END/SWAP TO RIG PUMP TO CIRCULATE	11:47	1.8	0	5
RIG PUMP FLOW BACK H2O	11:47	?	0	5
END/GREEN DYE TO SURFACE/CIRC	11:58	?	?	0
PLUG #3 PERFS @ 500'				
START CMT @ 15.8LB	12:09	1.6	10	0
GREEN DYE TO SURFACE 175SKS	12:21	2.3	120	36
END/GOOD CMT TO SURFACE 190SKS	12:23	2.3	120	39
RIG CREW START RIG DOWN	12:30			
WASH UP	12:30			
WELDER START DIG UP/CUT OFF	13:45			
CMT ABOUT 100' DOWN IN ANNULAR	15:00			
ANDPRODUCTION CASING				

OPERATOR: WYATT CHAPMAN

Accepted And Approved By:

HORSESHOE CANYON 3-28 7/13/20

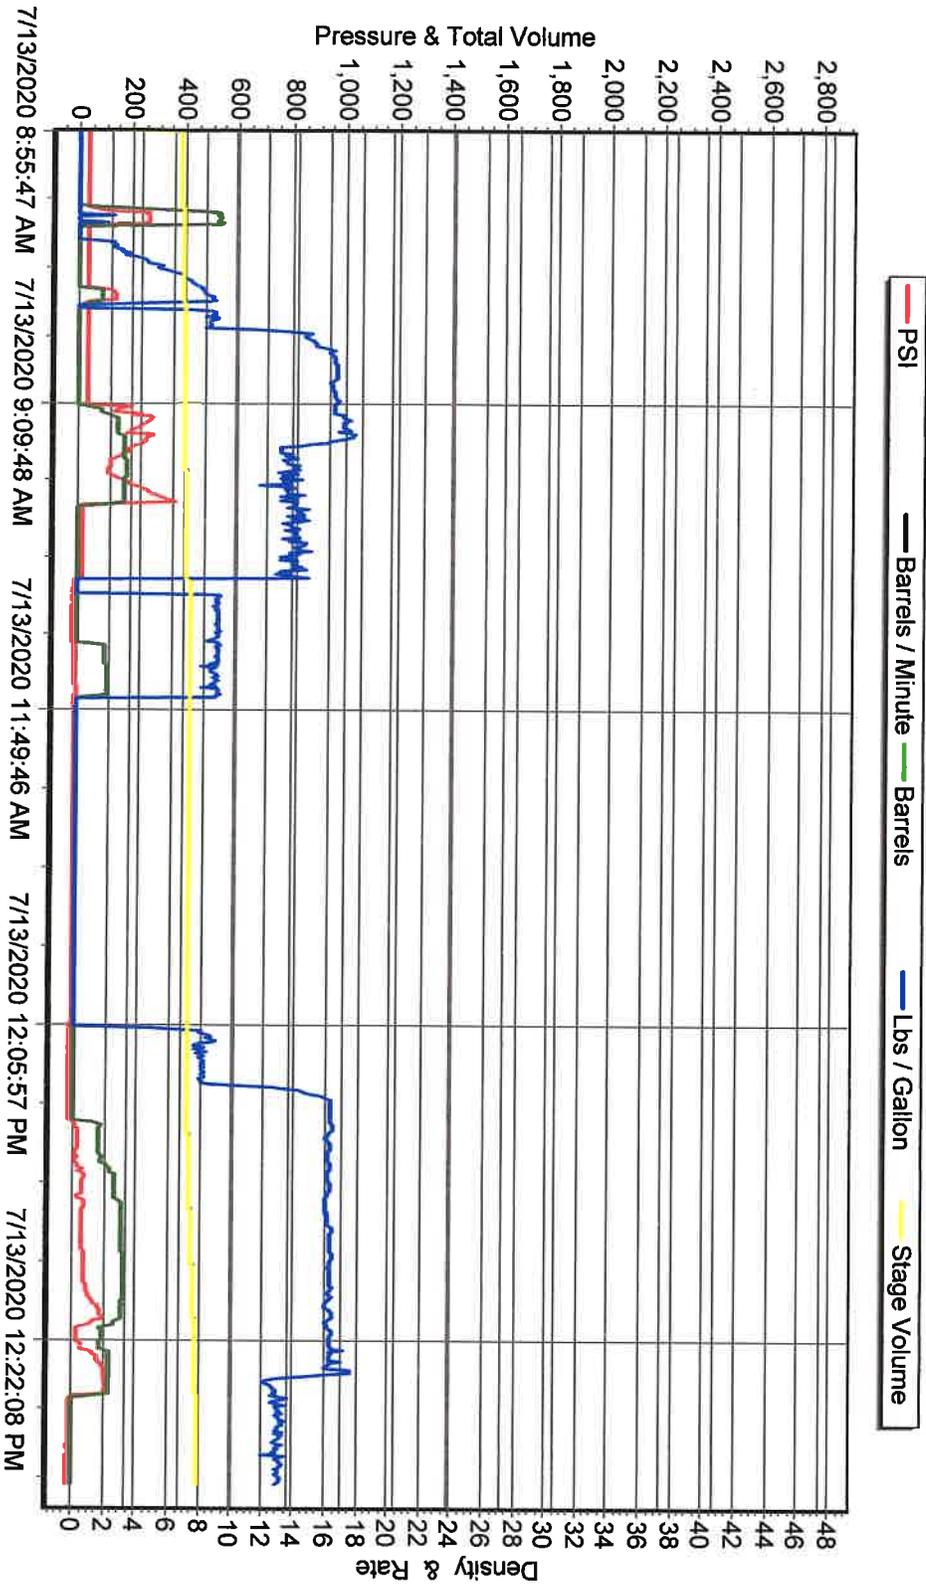

HORSESHOE CANYON 3-28 7/9/20

