



Well Name: WILMOTH PM C05-03

Daily Operations

Well Name	API	Job Type	Start Date	Summary
WILMOTH PM C05-03	05-123-14207	PLUG AND ABANDON	5/22/2019	MIRU RIG AND EQUIPMENT. CONTROL WELL. TBG-540PSI CSG-540PSI SC-0PSI CIRC 100BBLS OF FW. RECOVERED PLUNGER. ND TREE, NU BOPS. 250PSI LOW-2500PSI HIGH. GOOD TEST. POOH W/ 2.0625" TBG. RU WIRELINE AND SET CIBP @ 6602'. DUMP 2SKS G NEAT ON CIBP. LOAD HOLE AND TEST CIBP 500PSI 15 MINUTES. GOOD TEST. SWFN
WILMOTH PM C05-03	05-123-14207	PLUG AND ABANDON	5/23/2019	SAFETY MEETING. RU WIRELINE. RIH AND SHOOT PERF HOLES @ 2500' AND 2000'. RD WIRELINE. MU AND RIH W/ CIRC FOR 3.5" CSG ON 2.0625" TBG. SET CIRC @ 2400'. BROKE CIRC AND CLEANED UP PERFS WITH 35BBLS OF FW. PUMPED 183 SKS G NEAT COURTESY SQUEEZE. LEFT 2BBLS OF CMT ON TOP OF CIRC. POOH W/ 2.0625" TBG. RU WIRELINE AND RIH W/ JET CUTTER. CUT 3.5" CSG @ 575'. RD WIRELINE. CIRC 55BBLS OF FW, WELL CLEANED UP. ND BOPS, NU TREE. PUMPED SHOE/SURFACE PLUG. 261SKS G NEAT. RD RIG AND EQUIPMENT. TOPPED OFF WELL W/ 46 SKS. SDFN
WILMOTH PM C05-03	05-123-14207	PLUG AND ABANDON	5/24/2019	TAGGED TOC @ 60'. TOPPED OFF WELL WITH 8 SKS. MOVE OUT
WILMOTH PM C05-03	05-123-14207	PLUG AND ABANDON	2/5/2020	WH CUT CAP. CEMENT DEPTH BEFORE CUT: SURFACE. CMT DEPTH AFTER CUT: 6'. 0 SACKS TOP OFF.