

Well Name: Pargin Mtn Unit 2 **API #** 05-007-06098
Document Number: 693902244
Corrective Action: Barbed wire and wood fencing debris within the eastern project area.
Remove debris.

Wattles observed on cut-slope, and southwestern fill slope are largely out of alignment, full of sediment, and no longer functioning. While initial corrective action is addressed, wattles are not an adequate BMP in these areas.
Install long-term stormwater controls within the project area. Stormwater controls need to be selected, sized, installed, and maintained according to good engineering practices such as those described by CDOT in their erosion control manuals

Correction Action Due: 10/16/2020
Action Completed: 9/28/2020
Action Taken: Removed barbed wire and wood fencing debris within the eastern project area.

Removed nylon netting from wattles and disposed of them.
Dug ditch around the edge of the location to redirect runoff from the erosion damaged fill slope to a natural and flatted drainage area on the northern end of the project area.
Filled in and reseeded the area on the fill slope with erosion damage, and incorporated original terracing.
Raked out channeling and rills on the cut slope.

