

**FORM
INSP**

Rev
X/15

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

09/22/2020

Submitted Date:

10/08/2020

Document Number:

694500245

FIELD INSPECTION FORM

Loc ID _____ Inspector Name: NEIDEL, KRIS On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

OGCC Operator Number: 10551
Name of Operator: ANDEAVOR FIELD SERVICES LLC
Address: 539 S MAIN STREET
City: FINDLAY State: OH Zip: 45840

Findings:

1 Number of Comments
0 Number of Corrective Actions
 Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
Fischer, Alex		alex.fischer@state.co.us	
Schneider, Lindsay		Lindsay.Schneider@tsocorp.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
463345	SPILL OR RELEASE	CL	03/25/2019		-	Duncan B-6 Lateral 276	EI

General Comment:

On 8/25/2020 COGCC Staff, Kris Neidel inspected the Duncan B-6 Lateral spill path. Spill 463345 and Remediation #12865. Weather was clear and 55 degrees. Andeavor's Environmental Contractor, LTE (Dustin Held) was onsite to collect soil samples of the spill path. The spill path and un-impacted areas of the drainage were observed. No surface staining was observed. The area identified as SB-03 in REM Project 12865 was probed with a shovel to observe subsurface soil. In the side of the creek channel, on south side of creek bed, a deposit of black soil was observed (see Photo #6 attached). The deposit appeared to be fine black coal and fine gravel and sand. The black deposit had a strong hydrocarbon odor. A sample of the black soil was collected. COGCC staff, Kris Neidel probed other areas of the creek bed in the spill path and did not observe this deposit in the areas probed. This spill occurred on 3/14/2019, all impacted soils shall be remediated to table 910-1 standards. Required Action: within 30 days of receiving analytical results from lab, they shall be submitted on a Form 27 supplemental. See attached Photos.

Inspected Facilities

Facility ID: 463345 Type: SPILL OR API Number: - Status: CL Insp. Status: EI

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
694500246	photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5265136