

FORM
6Rev
02/20

State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

402518024

Date Received:

10/25/2020

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: Garrett Reddin

Name of Operator: NOBLE ENERGY INC

Phone: (720) 822-9993

Address: 1001 NOBLE ENERGY WAY

Fax:

City: HOUSTON State: TX Zip: 77070

Email: garrett.reddin@nblenergy.com

For "Intent" 24 hour notice required,

Name: Burns, Adam

Tel: (970) 218-4885

COGCC contact:

Email: adam.m.burns@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-22182-00

Well Name: KERN D

Well Number: 2-2JI

Location: QtrQtr: NWNE Section: 2 Township: 3N Range: 64W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.260210 Longitude: -104.516230

GPS Data: GPS Quality Value: 3.7 Type of GPS Quality Value: PDOP Date of Measurement: 08/25/2006

GPS Instrument Operator's Name: Paul Tappy

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☐ Yes ☒ No Estimated Depth:Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6840	6850			
NIOBRARA	6580	6646			
J SAND	7312	7372	04/25/2005	B PLUG CEMENT TOP	7240

Total: 3 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	582	400	582	0	VISU
1ST	7+7/8	4+1/2	11.6	7,458	210	7,458	6,194	CBL
S.C. 1.1				7,458	220	4,832	3,870	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6530 with 2 sacks cmt on top. CIBP #2: Depth 3932 with 2 sacks cmt on top.

CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.

CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 35 sks cmt from 2400 ft. to 2000 ft. Plug Type: CASING Plug Tagged: ☐

Set 65 sks cmt from 802 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☒

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 2500 ft. with 155 sacks. Leave at least 100 ft. in casing 2400 CICR Depth

Perforate and squeeze at 802 ft. with 195 sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Cut and Cap Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Stephanie Dionne

Title: Operations Tech Date: 10/25/2020 Email: stephanie.dionne@nblenergy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Haverkamp, Curtis Date: 11/2/2020

CONDITIONS OF APPROVAL, IF ANY:

Expiration Date: 5/1/2021

COA Type	Description
	<p>1) Provide 48-hour notice of plugging MIRU via electronic Form 42.</p> <p>2) After placing the shallowest hydrocarbon isolating plug (3932'), operator must wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or of fluid migration, contact COGCC engineering before continuing operations.</p> <p>3) The plug at 2500' needs to be placed and have an 8-hour WOC to assure that all fluid migration has been stopped. If that doesn't isolate the flow, additional attempts in front of the surface shoe plug will need to be attempted. Other downhole potential squeeze opportunities may need to be looked at before the 802' plug.</p> <p>4) Prior to placing the 802' plug: verify that all fluid migration (liquid or gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>5) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 532' or shallower and provide at least 10 sx plug at the surface.</p> <p>6) Leave at least 100' of cement in the wellbore for each plug.</p> <p>7) Properly abandon flowlines as per Rule 1105. File electronic Form 42 once abandonment is complete. Within 90 days of an operator completing abandonment requirements for an off-location flowline or crude oil transfer line, the operator must submit a Flowline Report, Form 44.</p> <p>8) With the Form 6 SRA operator must provide written documentation which positively affirms each COA has been addressed.</p>
	Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.
	<p>Prior to starting plugging operations a bradenhead test shall be performed if there has not been a reported bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <p>1) If, before opening the bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the COGCC within three (3) months of collecting the samples.</p> <p>If there is a need for sampling, contact COGCC engineering for verification of plugging procedure.</p>
	Submit Operator's Monthly Production Reports (Form 7) required for compliance with Rule 309 within 30 days. Missing 6/2007-10/2009; 10/2011-10/2014 for NB-CD. 8/2020.
	In accordance with the Notice to Operators (NTO): Timing for COGCC Forms adopted on 05/01/2020, this Form 6 Notice of Intent to Abandon is valid for 12 months from the date of approval expiring on 11/02/2021. This NTO does not alter the deadlines for submission of, or compliance with any other Commission rule or Form.

Attachment Check List

Att Doc Num	Name
402518024	FORM 6 INTENT SUBMITTED
402518025	WELLBORE DIAGRAM
402518026	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Permit	<ul style="list-style-type: none">-Confirmed as-drilled well location.-No other forms in process.-Confirmed productive intervals docnum:401115411.-Reviewed WBDs.-Production reporting delinquent.-Pass.	10/26/2020

Total: 1 comment(s)