

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Document Number:

402526962

Date Received:

11/06/2020

FIR RESOLUTION FORM

Overall Status: FRQ

CA Summary:

1 of 2 CAs from the FIR responded to on this Form

0 CA Completed
1 Factual Review Request

OPERATOR INFORMATION

OGCC Operator Number: 10531

Name of Operator: GRIZZLY OPERATING LLC

Address: 5847 SAN FELIPE #3000

City: HOUSTON State: TX Zip: 77057

Contact Name and Telephone:

Name: _____

Phone: () _____ Fax: () _____

Email: _____

Additional Operator Contact:

Contact Name

Phone

Email

.Grizzly

aaxelson@grizzlyenergylc.com

.Grizzly

sghan@grizzlyenergylc.com

COGCC INSPECTION SUMMARY:

FIR Document Number: 700701835

Inspection Date: 11/05/2020

FIR Submit Date: 11/05/2020

FIR Status: _____

Inspected Operator Information:

Company Name: GRIZZLY OPERATING LLC

Company Number: 10531

Address: 5847 SAN FELIPE #3000

City: HOUSTON State: TX Zip: 77057

LOCATION - Location ID: 334962

Location Name: MILLER-66S92W Number: 36SWNW County: _____

Qtrqr: SWN Sec: 36 Twp: 6S Range: 92W Meridian: 6
W

Latitude: 39.485861 Longitude: -107.622272

FACILITY - API Number: 05-045- -00 Facility ID: 334962

Facility Name: MILLER-66S92W Number: 36SWNW

Qtrqr: SWN Sec: 36 Twp: 6S Range: 92W Meridian: 6
W

Latitude: 39.485861 Longitude: -107.622272

CORRECTIVE ACTIIONS:

2 ☒ CA# 144187

Corrective Action: Repair all BMP's

Date: 11/26/2020

Response: FACTUAL REVIEW REQUEST

Basis for Review: CA dates are not per the guidelines

Since the COGCC does not provide an applicable basis for review option to the Operator, the selected option may not be applicable, but this response is needed to create full transparency for the record. The alleged vehicle

Operator Comment: tracking CA noted in the inspection photo with the comment "Vehicle tracking on to county road from lease road" is not valid. The section of road noted in the inspection photo is a County Road (Chipperfield Lane/County Road 326) and not the responsibility of the operator or within the jurisdiction of the COGCC. The lease/access road for this location begins at the locked gate located approximately 0.3 miles to the east of where the inspector's photo was taken. A review of Garfield County records will confirm.

The alleged "sediment migration" near the combustor is also being disputed, as there is no evidence of "sediment migration" which the Operator is assuming is referring to erosion. The noted area around the combustor is void of vegetation as this area is intentionally treated with herbicide as part of our bare ground treatments and fire safety program. The area around the combustor is within the working surface of the production facility and is a graveled surface which is considered final stabilization.

COGCC Decision: **Not Approved**

COGCC Representative:

COGCC Supervisor:

No documentation was provided to support this FIR.

OPERATOR COMMENT AND SUBMITTAL

Comment: .

I hereby certify that the statements made in this form are, to the best of my knowledge, true, correct, and complete.

Print Name: Scott Ghan

Signed: _____

Title: Senior EHS Specialist

Date: 11/6/2020 10:09:02 AM

ATTACHMENT LIST

View Attachments in Imaged Documents on COGCC website (<http://ogccweblink.state.co.us/>) - Search by Document Number.

<u>Document Number</u>	<u>Description</u>
------------------------	--------------------

402526962	FIR RESOLUTION SUBMITTED
-----------	--------------------------

Total Attach: 1 Files