

103-10942 Anderson 13-10 Operations Summary

The following is a daily account for this well of a larger OWP PA Project.

7/28/2020

10:30-12:00PM Road WOR 107 from BMU 2575 to Anderson 13-10. SIRU SICP 00. Open well up ND wellhead and NU BOP'S. RU workfloor and tbg. equip.

12-6PM RU Perforators Wireline. MU 3.625 guage ring and RIH 10,747' and tag solid. PBTD @ 10,747'. POOH w/ Guage ring. Talk w/ State Rep. will set plug above PBTD. RU CIBP on 4 1/2" setting tool, RIH w/ CIBP & set @ 10746'. POOH w/ setting tool. MU 4 1/2" bailer, RIH w/ bailer & fill w/ 2 SX cement. RIH w/ bailer w/ 2 sx cement, stack out out 189' and open bailer and drop cement. POOH w/ bailer. MU 3.625 guage ring w/ junk basket and RIH to CIBP @ 10,746'. POOH w/ guage ring. PU bailer and fill w/ 2 SX cement RIH to 4820' and tag. Lost another sack of cement in well bore. MU 20' of bailer and open ended and try to get to bottom. Tag plug @ 10,746. POOH w/ bailer and SD.

6PM SWIFN

6-6:30PM CT

7/29/2020

6:30-7AM CT, JSA MEETING W/ STATE REP. RUNNING BOND LOG

7AM-12PM MU Bond logging tools, RIH to 10,730 and start to log csg. Log to 9300' and logging tools quit working. POOH w/ tools. LD tools and try and get them working. NO-LUCK. MU New logging tools and RIH to 10,730 and log well from 10,730 to surface. TOC @ 7360' LD logging tools

12-2:30PM MU 20' cement bailer and rih to 10,738' and bail one sx cement on CIBP. POOH W/ bailer and fill bailer w/ another sx of cement and dump on top of CIBP. POOH w/ bailer and LD. RD Perforators Wireline.

2:30-6PM MU 2 3/8" collar on bottom of a jt. SU from float and RIH w/ 234 jts. 2 3/8" 4.7# 8RD. Tallied pipe. EOT @ 7512'. Ready to pump balance plug in the AM.

6PM SWIFN

6-6:30PM CT

7/30/2020

6:30-7AM CT, JSA MEETING WITH STATE REP, PUMPING BALANCE PLUG

7-8:30AM RU Blac Frac Cementing, pump 40 sx balance plug. Pump plug @ 3 BPM @ 600 psi and return to flat tank. RD Blac Frac.

8:30-9:30AM LD 87 jts 2 3/8" 4.7# 8RD tbg onto float.

9:30-11AM POOH w/ 147 jts tbg. and stand back in derrick. RU Perforators Wireline.

11-12PM MU 4 1/2" perf gun and RIH to 6802' and tag balance plug. Pull up and perf well @ 4760'. POOH w/ perf gun and LD gun. MU 4 1/2" setting tool w/ 4 1/2" retainer and RIH and set retainer @ 4710'. POOH w/ setting tool and RD Perforators.

12-1PM RU Blac Frac Cementing squeeze 44 sx cement through retainer and leave 11 sx on top. Unsting and RD Blac Frac.

1-2PM LD 52 jts 2 3/8" 4.7# 8RD tbg on float. POOH w/ 95 jts tbg. and stand back in derrick.

2-3PM RU Perforators wireline, MU 4 1/2" perf gun perf well @ 3115'. POOH w/ perf gun, MU 4 1/2" CICR and RIH and set @ 3065' POOH w/ setting tool RD Perforators.

3-5PM RU Blac Frac Cementing, Sting into retainer and break circ. up surface csg @ 3 BPM @ 600 psi. Squeeze 28 sx cement through retainer and leave 4 sx on top. RD Blac Frac and LD 14 jts 2 3/8" 4.7# 8RD tbg on float. Stand back 81 jts tbg. in derrick.

5PM SWIFN

5-5:30PM CT

7/31/2020

6:30-7AM CT, JSA w/ STATE REP. CEMENTING SURFACE

7-8:30PM 0 PSI on well, RU Perforators Wireline. MU and RIH 4 1/2" perf gun and perf well @ 2670'. POOH w/ perf gun. MU and RIH w/ 4 1/2" CICR and set it @ 2620' POOH w/ setting tool and RD Perforators. MU 4 1/2" stinger and RIH w/ 81 jts. 2 3/8" 4.7# 8RD tbg. and latch into retainer @ 2620'

8:30-10AM RU Blac Frac Cementing, Break circ. 2.5 BPM @ 800 psi. Mix 72 sx cement and squeeze 61 sxs cement through retainer, un-sting from retainer and leave 11 sxs cement on top. LD 81 jts 2 3/8" 4.7# 8RD tbg. onto float.

10AM-3PM RU Perforators and perf well @ 625'. RD Perforators. RD workfloor and tbg. equip. ND BOP'S and NU wellhead. RU Blac Frac Cementing. Mix 230 sxs cement and pump it down 4 1/2" csg. string and return up the surface csg. Clean pump and tank, lines and equipment. RD WOR 107. Road rig and equipment to Anderson 6-16 SIRU. SDFWE.

3PM SDFWE

3-6PM CT