

103-10972 Lake 6-22 Operations Summary

The following is a daily account for this well of a larger OWP PA Project.

8/11/2020

6:30-7:00 CREW TRAVEL AND SAFETY MTG
7:00-8:00 RIG UP STRETCH LINES, N/D WELL HEAD, N/U BOP, RIG UP WORK FLOOR AND TONGS
8:00-10:00 RIG UP WIRE-LINE, RIH WITH 3.625 GAUGE RING, TAGGED BPTD AT 6347', TOOH RIG DOWN WIRE-LINE
10:00-1:00 RIH WITH 4-1/2" BIT AND BIT SUB, TAG ON JT 199, AT 6347', RIG UP POWER SWIVEL
1:00-2:00 START PUMPING DOWN 4-1/2" CSG AND RETURNING UP TBG, DRILL DOWN JT 199 AND 200, TO 6420',
HAD OBSTRUCTION IN CSG, CALLED IT GOOD RACK OUT POWER SWIVEL,
2:00-4:00 LAY DOWN 58 JTS ON TRAILOR, STAND BACK 142 JTS IN DERRICK
4:00-5:00 RIG UP WIRE-LINE, RIH WITH 4-1/2" CIBP SET AT 6100', TOOH RIG DOWN WIRE-LINE, SWIFN CLEAN UP
TOOLS AND LOCATION
5:00-5:30 CREW TRAVEL

8/12/2020

6:30-7:00 CREW TRAVEL AND SAFETY MTG
7:00-9:15 RIG UP WIRE-LINE, RIH AND DUMP BAIL 2 SXS ON TOP OF CIBP AT 6100', TOOH SHOOT PERFS AT 4610',
SET CIGR AT 4560', TOOH RIG DOWN WIRE-LINE
9:15-11:00 RIH WITH STINGER AND 142 JTS, STING INTO CIGR AT 4560' GET INJECTION RATE OF 2.5 BPM AT 1400
PSI, MIX AND PUMP 75SXS INTO CIGR, AND PUT 25 SXS ON TOP
11:00-12:30 LAY DOWN 47 JTS 13 SLOW, STAND BACK 95 JTS IN DERRICK
12:30-1:30 RIG UP WIRE-LINE, RIH SHOOT PERF HOLLS AT 3110, SET CIGR AT 3059', TOOH RIG DOWN WIRE-
LINE
1:30-2:30 RIH WITH STINGER AND 95 JTS, STING IN CIGR AT 3059', GOT INJECTION RATE OF 3.5 BPM AT 500 PSI,
MIX AND PUMP 35 SXS INTO CIGR AND 5 ON TOP
2:30-3:15 LAY DOWN 40 JTS 5 SLOW, STAND BACK 55 JTS IN DERRICK
3:15-4:00 RIG UP WIRE-LINE SHOOT PERFS AT 1823', SET CIGR AT 1773', TOOH RIG DOWN WIRE-LINE
4:00-4:30 RIH WITH STINGER AND 50 JTS EOT AT 1600', SWIFN CLEAN UP TOOLS AND LOCATION
4:30-5:00 CREW TRAVEL

8/13/2020

6:30-7:00 CREW TRAVEL AND SAFETY MTG
7:00-7:45 RIH WITH 4 JTS, STING INTO CIGR AT 1773', MIX AND PUMP 65 SXS INTO CIGR, AND 15 SXS ON TOP
7:45-8:15 LAY DOWN 37 JTS 10 SLOW STAND BACK 18 JTS IN DERRICK
8:15-8:45 RIG UP WIRE-LINE SHOOT PERFS AT 628', SET CIGR AT 578', TOOH RIG DOWN WIRE-LINE
8:45-9:30 RIH WITH 18 JTS STING INTO CIGR AT 578', MIX AND PUMP 35 SXS INTO CIGR AND PUT 5 SXS ON TOP
9:30-10:30 LAY DOWN 18 JTS , RIG UP WIRE-LINE, SHOOT PERF HOLES AT 50', TOOH RIG DOWN WIRE-LINE, GET
INJECTION RATE OF 3BPM AT 0 PSI, RIG DOWN WORK FLOOR AND TONGS, N/D BOP, N/U WELL HEAD
10:30-11:00 MIX AND PUMP 20 SXS DOWN 4-1/2" CSG, AND RETURN UP SURFACE CSG
11:00-12:00 RIG DOWN WRAP LINES, GET EVERYTHING READY TO MOVE TO THE LAKE 6-21
12:00-2:30 ROAD RIG FROM THE LAKE 6-22 TO THE LAKE 6-21, SPOT IN RIG UP STRETCH LINES, RUN PUMP LINE
AND RETURN LINE GET EVERYTHING READY TO TRY AND KILL WELL IN THE MORNING
2:30-3:00 CREW TRAVEL